

Greater Boston Lead Paint Testing
22 Joslin ST, Lunenburg, MA 01462
Tel:617-515-1023 JoeSlyman@Hotmail.com

LETTER OF FULL INITIAL COMPLIANCE

Mr Xavier Velasco-Suarez

21 Olde Lantern RD

Acton, MA 01720

Dear Xavier Velasco-Suarez,

This letter is to certify that I inspected your property located at 549 Great Elm Way, Unit _____, and relevant interior and exterior common areas, in the City/Town of Acton for dangerous levels of lead according to 105 CMR 460.730 of the Regulations for Lead Poisoning Prevention and Control, and determined that there were no violations of the Lead Law, Massachusetts General Laws, Chapter 111, section 197. The inspection was conducted on 02/ 22 /13.

☒ I also certify that I observed no evidence or signs that unauthorized deleading activities may have occurred in this unit or in its associated common areas.

Please be advised that Massachusetts law requires that only certain residential surfaces be free of lead paint. Thus, this letter does not mean that your property contains no lead paint. **The residential premises or dwelling unit and relevant common areas shall remain in compliance with the requirements of the Lead Laws referenced above only as long as there continues to be no peeling, chipping or flaking lead paint or other accessible leaded materials, as long as coverings and/or encapsulants forming an effective barrier over such paint or other leaded materials remain in place, and as long as surfaces reversed to correct lead hazards remain reversed and securely in place.** The law grants you a 30-day maintenance period to repair deteriorated lead paint or detached coverings over such paint, and to clean up, during which time this Letter remains valid. The initial inspection report indicates which surfaces, if any, contain a dangerous level of lead, as well as those surfaces, if any, that were covered upon initial inspection.

The CLPPP authorized serial number for this Letter of Initial Compliance is 37471430022213-549. This number is tracked and unique to this address and unit.

DO NOT LOSE THESE DOCUMENTS. If the documents are lost you will be required to have additional private inspector services that may cost you significant amounts of money. This Letter of Full Initial Compliance is only for the address and unit number noted above. If you change the street address, unit/apartment number or any other identifying information pertaining to the residential premises referred to in this Letter of Full Initial Compliance, this Compliance Letter may be considered null and void by the Department of Public Health and/or a municipal health office.

Do not alter this document in any way. Altering this document is fraudulent and may endanger the health and safety of a child which may result in significant legal consequences. In addition to any potential civil liability which may arise as the result of the alteration of this Letter of Compliance, the Massachusetts Department of Public Health's Childhood Lead Poisoning Prevention program may seek criminal prosecution of any person who alters this document after it is originally issued.

Sincerely,

Joseph Slyman
Inspector



11430
License #

02/ 22 /13
Date

Greater Boston Lead Paint Testing

22 Joslin ST, Lunenburg, MA 01462
Tel: 617-515-1023 Email: JoeSlyman@Hotmail.com

Lead Inspection / Risk Assessment Report

Page 1 Of 16

St.# 549 Street Name GREAT ELM Street Type WAY Unit 8
City ACTON Zip Code 01718

Owner Name: XAVIER VELASCO-SUAREZ

Owner Address: 21 OLDE LANTERN RD, ACTON MA 01720

Contact Information: 978-387-7226 xvelasco@yahoo.com

Client Name (if different from owner):

Client Address:

Number of Rooms in Unit 8

Property Type:

Single Family

Multi Family # Units

Condominium ☒ # Units 277

Day Care Other:

Key:	Lead Column	Key:	Delead/ IC Method Column
COV	Covered	CAP	Capped
VB	Vinyl Baseboard	COV	Covered
MET	Metal	ENC	Encapsulated
VR	Vinyl Rep. Window	MI	Made Intact
MR	Metal Rep. Window	PRE	Prepared for Enc
NA	Not Accessible	VR/MR	Vinyl/Metal Rep Window
NC	No Coating	SFR	Storm Frame Removed
Tile	Tile (testing suggested)		Component Does not Exist
DC	Dropped Ceiling		

Laundry in Basement? Yes ☐ No ☒
Finished Space in Basement? Yes ☐ No ☒

Testing Method Used:


Na₂S Exp. Date
X-Ray Fluorescence
Model LPA-1 Serial # 3377

Comments / Notes Laundry in kitchen. 1st FLOOR Open Floor Plan.


Floor# 1 (this is the level within building of unit being inspected)

Floor# 2


Property Diagram/ Unit Labels

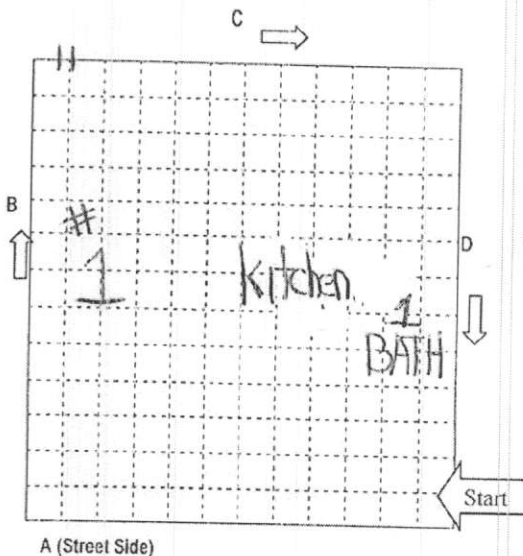

A (Street Side)

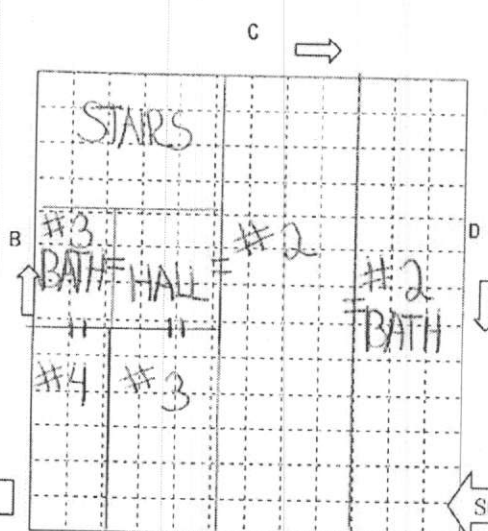

A (Street Side)

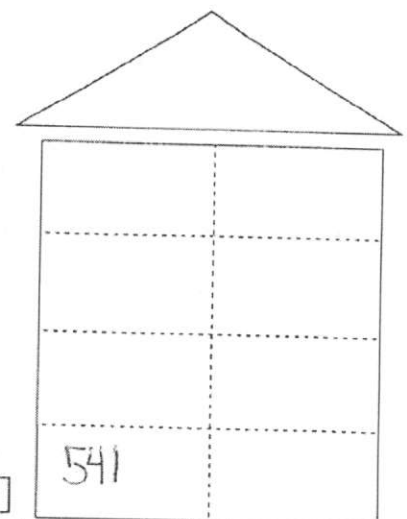

A (Street Side)

Pb (lead) equal to or greater than 1.0 mg/cm² with x-ray fluorescence or positive with Na₂S is **Dangerous**.

XRF Calibration Recorded in Log Book
Address verified through USPS
Research on Lead-Related History for Address
www.state.ma.us/dph/clppp or 800-532-9571

☒
☒
☒

✓ -Check off when complete
✓ -Check off when complete
✓ -Check off when complete

Inspector Name Joseph Slyman Lic # 11430

Signature J. Slyman

Date 02/22/13

Page 2 of 16

Signature _____

ADDRESS: 549 Great Elm Way
REOCCUPANCY CERTIFICATE HISTORY

Apt# - City Acton Page 3 of 16

Certificate of Reoccupancy
Only after High/Mod Risk (# rooms rule)

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Reoccupancy
Only after High/Mod Risk (# rooms rule)

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Reoccupancy
Only after High/Mod Risk (# rooms rule)

Inspector Name: _____, Lic# _____
Signature _____

COMPLIANCE HISTORY

Letter of Full Initial Compliance
<u>0222113</u>
No prior history/No signs of UD

Inspector Name: Joe Symm, Lic# 1430
Signature [Signature]

Letter of Interim Control
No prior Comp. Expires in 1 yr.

Inspector Name: _____, Lic# _____
Signature _____

Recertification of Interim Control
Expires 2 yrs from original Interim Control

Inspector Name: _____, Lic# _____
Signature _____

Letter of Full Deleading Compliance
Dust wipes if No Reocc.

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Maintained Compliance
No Work= No Dust Work = 7 Dust

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Restored Compliance
Dust wipes and auth. people

Inspector Name: _____, Lic# _____
Signature _____

COMPLIANCE HISTORY (CONT.)

Certificate of Maintained Compliance
No Work= No Dust Work = 7 Dust

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Restored Compliance
Dust wipes and auth. people

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Maintained Compliance
No Work= No Dust Work = 7 Dust

Inspector Name: _____, Lic# _____
Signature _____

Certificate of Restored Compliance
Dust wipes and auth. people

Inspector Name: _____, Lic# _____
Signature _____

OTHER HISTORY: WAIVERS/UD/EPA RRP

Approved CLPPP Waiver
Attach to Comp Docs

CLPPP Insp. Name: _____, Lic# _____
Signature _____

Approved CLPPP Waiver
Attach to Comp Docs

CLPPP Insp. Name: _____, Lic# _____
Signature _____

UD / DES Visual Reinspection
No LOC Issued

Inspector Name: _____, Lic# _____
Signature

P
F

UD / DES Visual Reinspection
No LOC Issued

Inspector Name: _____, Lic# _____
Signature

P
F

UD / DES Dust Taken
No LOC Issued

Inspector Name: _____, Lic# _____
Signature

P
F

UD/DES Dust Taken
No LOC Issued

Inspector Name: _____, Lic# _____
Signature

P
F

Page 4 of 16 **EXPLANATION OF LEAD INSPECTION / RISK ASSESSMENT REPORT FORM COLUMNS**

This page provides general information needed to understand the lead inspection/risk assessment report. However, you should speak with the inspector/risk assessor before you start to do any work on your home.

SIDE	Refers to A, B, C, or D side of the building or room. See the diagram on the cover sheet. The "A" side of the building or room is the side facing the street that gives the property its address (usually, it is the front of the building). Keeping your back to this street, from the "A" side move clockwise to the "B" side on your left, the "C" side opposite you, and the "D" side to the right. Numbering is from left to right.
LOCATION/ SURFACE	Refers to the building component(s) being tested. Some surfaces may be made up of more than one part. For example, "Baseboard" may refer to four separate pieces of wood (one on each wall), but is still considered one surface.
LEAD	The actual lead result. Each surface tested must have a result recorded in the "Lead" column. • A number shows that the surface was tested with an XRF analyzer. A number (or average number) equal to or greater than 1.0 mg/cm² is a dangerous level of lead. • A "pos" or "neg" shows that the surface was tested with sodium sulfide. "Pos" means that there is a dangerous level of lead. • "N/A" means that the inspector was not able to test the surface. Unless the owner can get a sample to test, the inspector must assume the surface contains lead and require it to be deleaded, if necessary. • "MET" or "MR" means that a metal surface was not tested and only needs to be intact, even if it is a leaded surface. However, metal handrails, metal window sills, and metal railing caps, need to be deleaded if they test equal to or greater than 1.0 mg/cm², or is marked "N/A." • For key to abbreviations like "COV", "VB", "VR" or "MR", "NC", "Tile", "DC", see the cover page. • When a component box is slashed and there are test results above and below the diagonal line, the result on the "bottom" represents results below 5 ft. and the "top" result indicates the test result above 5 ft.
TYPE OF HAZARD	Not all lead paint must be deleaded. This column tells you IF and WHY a surface needs deleading. The deleading standards below may not apply for Interim Controls. Speak to your risk assessor for more information. • "M/I" circled means that the surface is a moveable/impacted surface and must be deleaded in its entirety. • "SF" circled indicates that there is a storm frame present which requires the blind stop and exterior sill be deleaded as interior moveable / impacted surfaces. • "A/M" circled means that the surface is "accessible mouthable" and must be deleaded to a minimum of five feet high, four inches in from the edge or corner. • "L" circled means that the surface is loose and must, at minimum, be made intact. • If more than one choice is circled, the rules for deleading may change depending upon what method of deleading you choose. Speak to the inspector for more information. • "N/A" means the inspector was unable to determine if the surface was a lead hazard. The person doing the deleading must check this surface and follow all the rules for deleading. Speak to the inspector for more information. • If nothing is circled in the column, then it is likely the surface does not need deleading. Speak to the inspector for more information. Remember, this does not mean the entire surface is lead free, it just does not require deleading in its current condition.
URG HAZ?	This column is only completed during a risk assessment. A risk assessment is an evaluation of a home's suitability for Interim Control. Only a licensed risk assessor can do a risk assessment, not all inspectors are risk assessors. If "Y" is circled, then this surface is considered an "Urgent Lead Hazard" and some type of deleading work is required to qualify for Interim Control.
IC DATE	The date the licensed risk assessor determines the surface meets the standards for Interim Control.
IC METH	The deleading method or structural repair done to qualify the surface for Interim Control. Refer to the deleading codes key on the cover page.
DELEAD DATE	The date that the lead inspector reinspects the surface and finds that it has been successfully brought back into compliance.
DELEAD METH	The method used to bring a surface into full compliance. Refer to codes in the Key on the cover page of the PCAD
EXCLUDED SURFACES	The amount of loose paint on a surface as measured by the lead inspector. "N/A" means that the inspector was not able to measure the loose paint, but has determined it is more than the cut-off for moderate risk making intact.

Joe Slyman

Inspector (print)

I/430

Lic #

Signature

02/22/13

Date

Page 5 of 16

Risk Assessor (print)

Lic #

Signature

Date

Address of Property:

549 Great Elm Way Apt. #

City: Acton

ROOM # 1

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	0.1	A/M L N/A	Y				
A B C D	Low Walls		A/M L N/A	Y				
A B C D	Baseboards	0.3	A/M L N/A	Y				
A B C D	Chair Rail		A/M L N/A	Y				
A B C D	Radiator	Met	A/M L N/A	Y				
	Floor	0.0	A/M L N/A	Y				
	Ceiling	0.3	A/M L N/A	Y				
A B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.0	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.2	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.0	A/M L N/A	Y				
3 4	Threshold	0.4	A/M L N/A	Y				
A B	Door	MR	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold	0.0	A/M L N/A	Y				
A B	Door	MR	A/M L N/A	Y				
C D	Door Casing	0.3	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold	0.5	A/M L N/A	Y				
A	Closet Door	0.1	A/M L N/A	Y				
B	Cl Casing	0.3	A/M L N/A	Y				
C	Closet Jamb	0.2	A/M L N/A	Y				
D	Closet Walls	0.2	A/M L N/A	Y				
	Cl Baseboard	0.1	A/M L N/A	Y				
1	Closet Pole	Met	A/M L N/A	Y				
2	Closet Shelf	0.0	A/M L N/A	Y				
3	Cl Supports	0.2	A/M L N/A	Y				
4	Closet Floor	0.1	A/M L N/A	Y				
	Closet Ceiling	0.1	A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A B	Fireplace	0.3	A/M L N/A	Y				
C D	Mantle	0.1	A/M L N/A	Y				
A B C D	Win Above 5'		A/M L N/A	Y				
	Ceiling Molding		A/M L N/A	Y				
13	elec Box	0.1	A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Joe Slyman

Inspector (print)

I1430

Lic #

Signature

02/22/13

Date

Page 6 of 16

Risk Assessor (print)

Lic #

Signature

Date

Address of Property:

549 Great Elm Way

Apt. #

City: Acton

ROOM #

2

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Up Walls	0.1	A/M L N/A	Y				
A B	Low Walls		A/M L N/A	Y				
A B	Baseboards	0.2	A/M L N/A	Y				
A B	Chair Rail		A/M L N/A	Y				
A B	Radiator	N/A	A/M L N/A	Y				
	Floor	CCV	A/M L N/A	Y				
	Ceiling	N/A	A/M L N/A	Y				
A B	Door	0.2	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.3	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.4	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A	Closet Door	0.0	A/M L N/A	Y				
B	Cl Casing	0.2	A/M L N/A	Y				
C	Closet Jamb	0.1	A/M L N/A	Y				
D	Closet Walls	0.0	A/M L N/A	Y				
	Cl Baseboard	0.2	A/M L N/A	Y				
1	Closet Pole		A/M L N/A	Y				
2	Closet Shelf	0.1	A/M L N/A	Y				
3	Cl Supports	0.0	A/M L N/A	Y				
4	Closet Floor	CCV	A/M L N/A	Y				
	Closet Ceiling	N/A	A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	0.0	M/I A/M L N/A	Y				
B	Win Apron	0.2	A/M L N/A	Y				
C	Win Casing	0.1	A/M L N/A	Y				
D	Header Stop	N/A	M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash	MR	M/I A/M L N/A	Y				
2	Exterior Sill	MR	M/I SF L N/A	Y				
3	Part Bead	MR	M/I L N/A	Y				
4	Blind Stop	MR	M/I SF L N/A	Y				
	Win Ext Sash	MR	M/I L N/A	Y				
A	Window Sill	0.2	M/I A/M L N/A	Y				
B	Win Apron	0.4	A/M L N/A	Y				
C	Win Casing	0.2	A/M L N/A	Y				
D	Header Stop	N/A	M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash	MR	M/I A/M L N/A	Y				
2	Exterior Sill	MR	M/I SF L N/A	Y				
3	Part Bead	MR	M/I L N/A	Y				
4	Blind Stop	MR	M/I SF L N/A	Y				
	Win Ext Sash	MR	M/I L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A B	Fireplace		A/M L N/A	Y				
C D	Mantle		A/M L N/A	Y				
A B	Win Above 5'		A/M L N/A	Y				
C D	Ceiling Molding		A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Inspector (print)

Lic #

Signature _____

Date _____

Page 7 of 16

Lic #

Signature _____

Date _____

549 Great Elm Way

Appl. #

City:

CONTINUATION OF ROOM (

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
#	Door Jamb	.	A/M L N/A	Y				
	Threshold	.	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
#	Door Jamb	.	A/M L N/A	Y				
	Threshold	.	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
#	Door Jamb	.	A/M L N/A	Y				
	Threshold	.	A/M L N/A	Y				
	Closet Door	0.0	A/M L N/A	Y				
(A)	Cl Casing	0.1	A/M L N/A	Y				
B	Closet Jamb	0.0	A/M L N/A	Y				
C	Closet Walls	0.2	A/M L N/A	Y				
D	Cl Baseboard	0.1	A/M L N/A	Y				
#	Closet Pole	/	A/M L N/A	Y				
	Closet Shelf	0.1	A/M L N/A	Y				
	Cl Supports	0.3	A/M L N/A	Y				
	Cl Drawers	/	A/M L N/A	Y				
	Cl Dr Frame	/	A/M L N/A	Y				
	Closet Floor	(0)	A/M L N/A	Y				
	Closet Ceiling	N/A	A/M L N/A	Y				
A B	Shlvs Above 5'	.	A/M L N/A	Y				
C D								
A B	Cab Above 5'	.	A/M L N/A	Y				
C D								
A B	Cab Above 5'	.	A/M L N/A	Y				
C D								
A B	Up Cab Frame	.	A/M L N/A	Y				
C D	Up Cab Door	.	A/M L N/A	Y				
	Up Cab Walls	.	A/M L N/A	Y				
#	Up Cab Shlvs	.	A/M L N/A	Y				
	Supports	.	A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

[illegible]

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed dealer.

NOTE: Containers listed in these boxes can be made intact only by a licensed deleader.									
SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD	SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

LEPA Repriming Cont. 8/78

Joe Slyman
Inspector (print)I/430
Lic #

Signature

02/22/13
Date

Page 8 of 16

Risk Assessor (print)

Lic #

Signature

Date

Address of Property: 549 Great Elm Way

Apt. #

City: Acton

ROOM # 3

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Up Walls	0.1	A/M L N/A	Y				
A B	Low Walls		A/M L N/A	Y				
A B	Baseboards	0.3	A/M L N/A	Y				
A B	Chair Rail		A/M L N/A	Y				
A B	Radiator		A/M L N/A	Y				
	Floor	CGV	A/M L N/A	Y				
	Ceiling	N/A	A/M L N/A	Y				
A B	Door	0.1	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.2	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.4	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.2	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door		A/M L N/A	Y				
C D	Door Casing		A/M L N/A	Y				
1 2	Door Jamb		A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door		A/M L N/A	Y				
C D	Door Casing		A/M L N/A	Y				
1 2	Door Jamb		A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A	Closet Door	0.1	A/M L N/A	Y				
B	Cl Casing	0.3	A/M L N/A	Y				
C	Closet Jamb	0.1	A/M L N/A	Y				
D	Closet Walls	0.2	A/M L N/A	Y				
	Cl Baseboard	0.4	A/M L N/A	Y				
1	Closet Pole		A/M L N/A	Y				
2	Closet Shelf	0.1	A/M L N/A	Y				
3	Cl Supports	0.3	A/M L N/A	Y				
4	Closet Floor	CGV	A/M L N/A	Y				
	Closet Ceiling	N/A	A/M L N/A	Y				

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	0.0	M/I A/M L N/A	Y				
B	Win Apron	0.3	A/M L N/A	Y				
C	Win Casing	0.4	A/M L N/A	Y				
D	Header Stop	N/A	M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash	MR	M/I A/M L N/A	Y				
2	Exterior Sill	MR	M/I SF L N/A	Y				
3	Part Bead	MR	M/I L N/A	Y				
4	Blind Stop	MR	M/I SF L N/A	Y				
	Win Ext Sash	MR	M/I L N/A	Y				
A	Window Sill	0.3	M/I A/M L N/A	Y				
B	Win Apron	0.2	A/M L N/A	Y				
C	Win Casing	0.1	A/M L N/A	Y				
D	Header Stop	N/A	M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash	MR	M/I A/M L N/A	Y				
2	Exterior Sill	MR	M/I SF L N/A	Y				
3	Part Bead	MR	M/I L N/A	Y				
4	Blind Stop	MR	M/I SF L N/A	Y				
	Win Ext Sash	MR	M/I L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A B	Fireplace		A/M L N/A	Y				
C D	Mantle		A/M L N/A	Y				
A B	Win Above 5'		A/M L N/A	Y				
C D	Ceiling Molding		A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

Joe Symon
Inspector (print)I1430
Lic #

Signature

02/22/13
Date

Page 9 of 16

Risk Assessor (print)

Lic #

Signature

Date

Address of Property: 549 Great Elm Way Apt. #

City: Acton

ROOM # 4

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Up Walls	0.2	A/M L N/A	Y				
A B	Low Walls		A/M L N/A	Y				
A B	Baseboards	0.1	A/M L N/A	Y				
A B	Chair Rail		A/M L N/A	Y				
A B	Radiator	N/A	A/M L N/A	Y				
	Floor	0.0	A/M L N/A	Y				
	Ceiling	N/A	A/M L N/A	Y				
A B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.2	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door		A/M L N/A	Y				
C D	Door Casing		A/M L N/A	Y				
1 2	Door Jamb		A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door		A/M L N/A	Y				
C D	Door Casing		A/M L N/A	Y				
1 2	Door Jamb		A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A	Closet Door	0.0	A/M L N/A	Y				
B	Cl Casing	0.3	A/M L N/A	Y				
C	Closet Jamb	0.2	A/M L N/A	Y				
D	Closet Walls	0.0	A/M L N/A	Y				
	Cl Baseboard	0.1	A/M L N/A	Y				
1	Closet Pole		A/M L N/A	Y				
2	Closet Shelf	0.0	A/M L N/A	Y				
3	Cl Supports	0.1	A/M L N/A	Y				
4	Closet Floor	0.0	A/M L N/A	Y				
	Closet Ceiling	N/A	A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	0.1	M/I A/M L N/A	Y				
B	Win Apron	0.0	A/M L N/A	Y				
C	Win Casing	0.3	A/M L N/A	Y				
D	Header Stop	N/A	M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash	MR	M/I A/M L N/A	Y				
2	Exterior Sill	MR	M/I SF L N/A	Y				
3	Part Bead	MR	M/I L N/A	Y				
4	Blind Stop	MR	M/I SF L N/A	Y				
	Win Ext Sash	MR	M/I L N/A	Y				
A	Window Sill	0.0	M/I A/M L N/A	Y				
B	Win Apron	0.1	A/M L N/A	Y				
C	Win Casing	0.0	A/M L N/A	Y				
D	Header Stop	N/A	M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash	MR	M/I A/M L N/A	Y				
2	Exterior Sill	MR	M/I SF L N/A	Y				
3	Part Bead	MR	M/I L N/A	Y				
4	Blind Stop	MR	M/I SF L N/A	Y				
	Win Ext Sash	MR	M/I L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A B	Fireplace		A/M L N/A	Y				
C D	Mantle		A/M L N/A	Y				
A B	Win Above 5'		A/M L N/A	Y				
C D	Ceiling Molding		A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				
			A/M L N/A	Y				

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Joe Slyman

Inspector (print)

I1430

Lic #

Signature

02/22/13

Date

Page 10 of 16

Risk Assessor (print)

Lic#

Signature

Date

Address of Property: 549 Great Elm Way

Apt. #

City: Acton

KITCHEN & LAUNDRY

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	0.1	A/M L N/A	Y				
A B C D	Low Walls		A/M L N/A	Y				
A B C D	Baseboards	0.3	A/M L N/A	Y				
A B C D	Chair Rail		A/M L N/A	Y				
A B C D	Radiator	Met	A/M L N/A	Y				
	Floor	0.2	A/M L N/A	Y				
	Ceiling	0.1	A/M L N/A	Y				
A B	Door	MR	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	MR	A/M L N/A	Y				
3 4	Threshold	0.0	A/M L N/A	Y				
A B	Door	MR	A/M L N/A	Y				
C D	Door Casing	0.3	A/M L N/A	Y				
1 2	Door Jamb	MR	A/M L N/A	Y				
3 4	Threshold	0.2	A/M L N/A	Y				
A B	Door	0.2	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.0	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.2	A/M L N/A	Y				
C D	Door Casing	0.3	A/M L N/A	Y				
1 2	Door Jamb	0.2	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A	Closet Door	0.1	A/M L N/A	Y				
B	Cl Casing	0.3	A/M L N/A	Y				
C	Closet Jamb	0.2	A/M L N/A	Y				
D	Closet Walls	0.2	A/M L N/A	Y				
	Cl Baseboard	0.1	A/M L N/A	Y				
1	Closet Pole		A/M L N/A	Y				
2	Closet Shelf	0.3	A/M L N/A	Y				
3	Cl Supports	0.1	A/M L N/A	Y				
4	Closet Floor	0.2	A/M L N/A	Y				
	Closet Ceiling	N/A	A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A B	Up Cab Frame	0.0	A/M L N/A	Y				
C D	Up Cab Door	0.1	A/M L N/A	Y				
	Up Cab Walls	0.3	A/M L N/A	Y				
1 2	Up Cab Shlvs	0.0	A/M L N/A	Y				
3 4	Supports	0.1	A/M L N/A	Y				
	Low Cab Fram	0.2	A/M L N/A	Y				
A B	Low Cab Door	0.1	A/M L N/A	Y				
C D	Low Cab Walls	0.0	A/M L N/A	Y				
	Low Cab Shlvs	0.1	A/M L N/A	Y				
1 2	Supports	0.0	A/M L N/A	Y				
3 4	Drawers	0.2	A/M L N/A	Y				
A B C D	Win Above 5'		M/I A/M L N/A	Y				
			M/I A/M L N/A	Y				
			M/I A/M L N/A	Y				
			M/I A/M L N/A	Y				
			M/I A/M L N/A	Y				

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Inspector (print)

Lic #

Signature _____

Date _____

Page 11 Of 16

Risk Assessor (print)

Lic#

Signature

Date _____

Address of Property:

549 Great EIM WAY

Apt. #

City: ActonBATHROOM # 1

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	0.2	A/M L N/A	Y				
A B C D	Low Walls	0.1	A/M L N/A	Y				
A B C D	Baseboards	0.0	A/M L N/A	Y				
A B C D	Chair Rail	0.1	A/M L N/A	Y				
A B C D	Radiator	MET	A/M L N/A	Y				
-	Floor	0.4	A/M L N/A	Y				
-	Ceiling	0.2	A/M L N/A	Y				
A B	Door	0.1	A/M L N/A	Y				
C D	Door Casing	0.4	A/M L N/A	Y				
1 2	Door Jamb	0.3	A/M L N/A	Y				
3 4	Threshold	0.1	A/M L N/A	Y				
A B	Door	0.1	A/M L N/A	Y				
C D	Door Casing	0.4	A/M L N/A	Y				
1 2	Door Jamb	0.3	A/M L N/A	Y				
3 4	Threshold	0.1	A/M L N/A	Y				
A	Closet Door	0.1	A/M L N/A	Y				
B	CI Casing	0.1	A/M L N/A	Y				
C	Closet Jamb	0.1	A/M L N/A	Y				
D	Closet Walls	0.1	A/M L N/A	Y				
	CI Baseboard	0.1	A/M L N/A	Y				
1	Closet Pole	0.1	A/M L N/A	Y				
2	Closet Shelf	0.1	A/M L N/A	Y				
3	CI Supports	0.1	A/M L N/A	Y				
4	Closet Floor	0.1	A/M L N/A	Y				
	Closet Ceiling	0.1	A/M L N/A	Y				
A B	Up Cab Frame	0.1	A/M L N/A	Y				
C D	Up Cab Door	0.1	A/M L N/A	Y				
	Up Cab Walls	0.1	A/M L N/A	Y				
2	Up Cab Shlvs	0.1	A/M L N/A	Y				
4	Supports	0.1	A/M L N/A	Y				
		0.1	M/I A/M L N/A	Y				
		0.1	M/I A/M L N/A	Y				
		0.1	M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

[illegible]

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed dealer.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Inspector (print)

I 430

Lic #

Signature

02/22/13

Date _____

Page 12 Of 16

Risk Assessor (print)

Lic#

Signature _____

Date _____

Address of Property:

549 Great ELM WAY

Apt. #

City:

Date Acton

BATHROOM #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	0.1	A/M L N/A	Y				
A B C D	Low Walls	/	A/M L N/A	Y				
A B C D	Baseboards	0.3	A/M L N/A	Y				
A B C D	Chair Rail	/	A/M L N/A	Y				
A B C D	Radiator	N/A	A/M L N/A	Y				
-	Floor	0.2	A/M L N/A	Y				
-	Ceiling	0.0	A/M L N/A	Y				
A B	Door	0.2	A/M L N/A	Y				
C D	Door Casing	0.0	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold	/	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
1 2	Door Jamb	.	A/M L N/A	Y				
3 4	Threshold	.	A/M L N/A	Y				
A	Closet Door	.	A/M L N/A	Y				
B	CI Casing	.	A/M L N/A	Y				
C	Closet Jamb	.	A/M L N/A	Y				
D	Closet Walls	.	A/M L N/A	Y				
	CI Baseboard	.	A/M L N/A	Y				
1	Closet Pole	.	A/M L N/A	Y				
2	Closet Shelf	.	A/M L N/A	Y				
3	CI Supports	.	A/M L N/A	Y				
4	Closet Floor	.	A/M L N/A	Y				
	Closet Ceiling	.	A/M L N/A	Y				
B	Up Cab Frame	0.2	A/M L N/A	Y				
D	Up Cab Door	0.1	A/M L N/A	Y				
	Up Cab Walls	0.0	A/M L N/A	Y				
2	Up Cab Shlvs	0.1	A/M L N/A	Y				
4	Supports	0.0	A/M L N/A	Y				
	.	M/I	A/M L N/A	Y				
	.	M/I	A/M L N/A	Y				
	.	M/I	A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

[illegible]

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Inspector (print)

Lic #

Signature _____

Date _____

Page 15 of 16

Lic#

Signature _____

Date _____

549 Great Elm Way

Adt. #

City

BATHROOM #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	0.1	A/M L N/A	Y				
A B C D	Low Walls	/	A/M L N/A	Y				
A B C D	Baseboards	0.3	A/M L N/A	Y				
A B C D	Chair Rail	/	A/M L N/A	Y				
A B C D	Radiator	N/A	A/M L N/A	Y				
-	Floor	0.4	A/M L N/A	Y				
-	Ceiling	N/A	A/M L N/A	Y				
A B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold	/	A/M L N/A	Y				
A B	Door	0.1	A/M L N/A	Y				
C D	Door Casing	0.3	A/M L N/A	Y				
1 2	Door Jamb	0.2	A/M L N/A	Y				
3 4	Threshold	/	A/M L N/A	Y				
A	Closet Door	0.0	A/M L N/A	Y				
B	Cl Casing	0.1	A/M L N/A	Y				
C	Closet Jamb	0.3	A/M L N/A	Y				
D	Closet Walls	0.2	A/M L N/A	Y				
	Cl Baseboard	0.3	A/M L N/A	Y				
1	Closet Pole	/	A/M L N/A	Y				
2	Closet Shelf	0.1	A/M L N/A	Y				
3	Cl Supports	0.2	A/M L N/A	Y				
4	Closet Floor	0.1	A/M L N/A	Y				
	Closet Ceiling	N/A	A/M L N/A	Y				
A B	Up Cab Frame	.	A/M L N/A	Y				
C D	Up Cab Door	.	A/M L N/A	Y				
	Up Cab Walls	.	A/M L N/A	Y				
1 2	Up Cab Shlvs	.	A/M L N/A	Y				
3 4	Supports	/	A/M L N/A	Y				
		.	M/I A/M L N/A	Y				
		.	M/I A/M L N/A	Y				
		.	M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

[illegible]

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed dealer.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Inspector (print)

I 1430

Lic #

Signature _____

02/22/13

Date _____

Page 14 of 16

Risk Assessor (print)

Lic #

Signature _____

Date _____

Address of Property:

Adt. #

City: ACTON

STAIRCASE 1ST - 2nd Floor

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	0.2	A/M L N/A	Y				
A B C D	Low Walls	.	A/M L N/A	Y				
A B C D	Baseboards	0.4	A/M L N/A	Y				
A B C D	Chair Rail	.	A/M L N/A	Y				
A B C D	Radiator	.	A/M L N/A	Y				
-	Floor	CGV	A/M L N/A	Y				
-	Ceiling	N/A	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
1 2	Door Jamb	.	A/M L N/A	Y				
3 4	Threshold	.	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
1 2	Door Jamb	.	A/M L N/A	Y				
3 4	Threshold	.	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
1 2	Door Jamb	.	A/M L N/A	Y				
3 4	Threshold	.	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
1 2	Door Jamb	.	A/M L N/A	Y				
3 4	Threshold	.	A/M L N/A	Y				
A B	Door	.	A/M L N/A	Y				
C D	Door Casing	.	A/M L N/A	Y				
	Door Jamb	.	A/M L N/A	Y				
	Threshold	.	A/M L N/A	Y				
A	Closet Door	.	A/M L N/A	Y				
B	Cl Casing	.	A/M L N/A	Y				
C	Closet Jamb	.	A/M L N/A	Y				
D	Closet Walls	.	A/M L N/A	Y				
	Cl Baseboard	.	A/M L N/A	Y				
1	Closet Pole	.	A/M L N/A	Y				
2	Closet Shelf	.	A/M L N/A	Y				
3	Cl Supports	.	A/M L N/A	Y				
4	Closet Floor	.	A/M L N/A	Y				
	Closet Ceiling	.	A/M L N/A	Y				

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	.	M/I A/M L N/A	Y				
B	Win Apron	.	A/M L N/A	Y				
C	Win Casing	.	A/M L N/A	Y				
D	Header Stop	.	M/I A/M L N/A	Y				
	Int Stops	.	M/I A/M L N/A	Y				
1	Win Int Sash	.	M/I A/M L N/A	Y				
2	Exterior Sill	.	M/I SF L N/A	Y				
3	Part Bead	.	M/I L N/A	Y				
4	Blind Stop	.	M/I SF L N/A	Y				
	Win Ext Sash	.	M/I L N/A	Y				
A	Window Sill	.	M/I A/M L N/A	Y				
B	Win Apron	.	A/M L N/A	Y				
C	Win Casing	.	A/M L N/A	Y				
D	Header Stop	.	M/I A/M L N/A	Y				
	Int Stops	.	M/I A/M L N/A	Y				
1	Win Int Sash	.	M/I A/M L N/A	Y				
2	Exterior Sill	.	M/I SF L N/A	Y				
3	Part Bead	.	M/I L N/A	Y				
4	Blind Stop	.	M/I SF L N/A	Y				
	Win Ext Sash	.	M/I L N/A	Y				
	Newel Post	✓	A/M L N/A	Y				
	Railing Cap	✓	A/M L N/A	Y				
	Handrail	0.3	A/M L N/A	Y				
	Balusters	0.1	A/M L N/A	Y				
	Lower rail	✓	A/M L N/A	Y				
	Treads	CCV	A/M L N/A	Y				
	Risers	CCV	A/M L N/A	Y				
	Stringer	✓	A/M L N/A	Y				
	Floor Edge	CCV	A/M L N/A	Y				
	Floor Casing	✓	A/M L N/A	Y				
		.	M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 200 SQ. IN.)	IC DATE	IC METHOD

Joe Slyman

Inspector (print)

I1430

Lic #

[Signature]

Signature

02/22/13

Date

Page 15 of 16

Risk Assessor (print)

Lic #

Signature

Date

Address of Property: 549 Great Elm Way Apt. #

City: Acton

HALLWAY: Interior # or Common Hallway: Front Rear Floor #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Up Walls	0.0	A/M L N/A	Y				
A B	Low Walls		A/M L N/A	Y				
A B	Baseboards	0.1	A/M L N/A	Y				
A B	Chair Rail		A/M L N/A	Y				
A B	Radiator		A/M L N/A	Y				
	Floor	0.0	A/M L N/A	Y				
	Ceiling	N/A	A/M L N/A	Y				
B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
1 3	Door	0.4	A/M L N/A	Y				
C D	Door Casing	0.3	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.0	A/M L N/A	Y				
C D	Door Casing	0.1	A/M L N/A	Y				
1 2	Door Jamb	0.0	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door	0.3	A/M L N/A	Y				
C D	Door Casing	0.2	A/M L N/A	Y				
1 2	Door Jamb	0.1	A/M L N/A	Y				
3 4	Threshold		A/M L N/A	Y				
A B	Door		A/M L N/A	Y				
C D	Door Casing		A/M L N/A	Y				
#	Door Jamb		A/M L N/A	Y				
	Threshold		A/M L N/A	Y				
A	Closet Door		A/M L N/A	Y				
B	Cl Casing		A/M L N/A	Y				
C	Closet Jamb		A/M L N/A	Y				
D	Closet Walls		A/M L N/A	Y				
	Cl Baseboard		A/M L N/A	Y				
1	Closet Pole		A/M L N/A	Y				
2	Closet Shelf		A/M L N/A	Y				
3	Cl Supports		A/M L N/A	Y				
4	Closet Floor		A/M L N/A	Y				
	Closet Ceiling		A/M L N/A	Y				
A	Closet Door		A/M L N/A	Y				
B	Cl Casing		A/M L N/A	Y				
C	Closet Jamb		A/M L N/A	Y				
D	Closet Walls		A/M L N/A	Y				
	Cl Baseboard		A/M L N/A	Y				
1	Closet Pole		A/M L N/A	Y				
2	Closet Shelf		A/M L N/A	Y				
3	Cl Supports		A/M L N/A	Y				
4	Closet Floor		A/M L N/A	Y				
	Closet Ceiling		A/M L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A	Window Sill		M/I A/M L N/A	Y				
B	Win Apron		A/M L N/A	Y				
C	Win Casing		A/M L N/A	Y				
D	Header Stop		M/I A/M L N/A	Y				
	Int Stops		M/I A/M L N/A	Y				
1	Win Int Sash		M/I A/M L N/A	Y				
2	Exterior Sill		M/I SF L N/A	Y				
3	Part Bead		M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash		M/I L N/A	Y				
A B	Win Above 5'		M/I A/M L N/A	Y				
A B	Ceiling Molding		M/I A/M L N/A	Y				
C D			M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

EXCLUDED SURFACES: Surfaces listed in these boxes can be made intact only by a licensed deleader.

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 288 SQ. IN.)	IC DATE	IC METHOD

Joe Slyman
Inspector (print)I1420
Lic #J. J.
Signature02/22/13
Date

Page 16 of 16

Risk Assessor (print)

Lic#

Signature

Date

Address of Property:

549 Gresham Way

Apt. #

City: Acton

EXTERIOR C Side

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
C	Siding	04	L N/A	Y				
	Corner Boards	N/A	L N/A	Y				
	Lower Trim	/	L N/A	Y				
	Upper Trim	N/A	L N/A	Y				
	Win Above 5'	N/A	L N/A	Y				
	Porch Above 5'	/	L N/A	Y				
C	Storm Door	/	A/M L N/A	Y				
	Door	0.3	A/M L N/A	Y				
	Door Casing	0.3	A/M L N/A	Y				
	Door Jamb	0.3	A/M L N/A	Y				
	Threshold	0.1	A/M L N/A	Y				
	Kickplate	0.0	A/M L N/A	Y				
C	Storm Door	/	A/M L N/A	Y				
	Door	NR	A/M L N/A	Y				
	Door Casing	NR	A/M L N/A	Y				
	Door Jamb	NR	A/M L N/A	Y				
	Threshold	IVC	A/M L N/A	Y				
	Kickplate	/	A/M L N/A	Y				
C	Door	0.0	A/M L N/A	Y				
	Door Casing	0.0	A/M L N/A	Y				
	Door Jamb	0.0	A/M L N/A	Y				
	Threshold	0.2	A/M L N/A	Y				
	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	A/M L N/A	Y				
C	Window Sash	/	A/M L N/A	Y				
	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	A/M L N/A	Y				
	Window Sash	/	A/M L N/A	Y				
	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	A/M L N/A	Y				
C	Window Sash	/	A/M L N/A	Y				
	Lamp Post	/	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS:

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
C	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	A/M L N/A	Y				
	Window Sash	/	A/M L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Sash	/	A/M L N/A	Y				
	Cel Win Frame	/	A/M L N/A	Y				
C	Screen Frame	/	A/M L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Sash	/	A/M L N/A	Y				
	Cel Win Frame	/	A/M L N/A	Y				
	Screen Frame	/	A/M L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
C	Cel Win Sash	/	A/M L N/A	Y				
	Cel Win Frame	/	A/M L N/A	Y				
	Screen Frame	/	A/M L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Sash	/	A/M L N/A	Y				
	Cel Win Frame	/	A/M L N/A	Y				
C	Screen Frame	/	A/M L N/A	Y				
	Foundation	AC	L N/A	Y				
	Bulkhead	/	A/M L N/A	Y				
	Fences	/	A/M L N/A	Y				
	Shutters	/	A/M L N/A	Y				
	Newel post	/	A/M L N/A	Y				
C	Railing Cap	/	A/M L N/A	Y				
	Handrail	/	A/M L N/A	Y				
	Balusters	/	A/M L N/A	Y				
	Lower Rail	/	A/M L N/A	Y				
	Treads	/	A/M L N/A	Y				
	Risers	/	A/M L N/A	Y				
C	Stringer	/	A/M L N/A	Y				
	Lattice	/	A/M L N/A	Y				
	Drain Pipes	0.2	L N/A	Y				
	Elec Conduit	0.4	L N/A	Y				
	Oil Fill Pipe	/	L N/A	Y				
	Overhang Trim	N/A	A/M L N/A	Y				

Excluded Surfaces: Surfaces listed in this box can be made
intact only by a licensed deleader

Soil Test Results

(Must be less than 400 ppm for play area / 1200 ppm for bare soil)

SIDE	LOCATION	MEASURE: LOOSE PAINT (MORE THAN 1440 SQ. IN.)	IC DATE	IC METH
C				
C				
C				
C				

LOCATION	AREA MEASUREMENT [Square Feet)	RESULT (PPM)	REMED DATE	REMED METH
Play Area				
Bare Soil				

Comments: