

Anderson Lead Inspections

Stow, MA 01775

www.andersonlead.com

Craig Anderson, Lic # M-3801
Master Inspector/Risk Assessor

(978) 875-3081
canderson@andersonlead.com

Lead Inspection / Risk Assessment

St # 90 Street Name Main Street Type St Unit ---none---
City Acton Zip Code 01720

Owner Name: Brett Kratchman and Corrine AmiraultOwner Address: 90 Main St, Acton, MA 01720Contact Information: (617) 838-3279

Client Name (if different from owner): _____

Client Address: _____

Key	Lead Column	Key	Delead/IC Method Column	Key	Delead/IC Method Column
COV	Covered	COV	Covered	REM	Removed
DC	Drop Ceiling	DIP	Dipped	REP	Replaced
MET	Metal	ENC	Encapsulated	SCR	Scraped
MR	Metal Rep Window	INT	Intact	SFR	Storm Frame Removed
NA	Not Accessible	MI	Made Intact	SLD	Sealed
NC	No Coating	PRE	Prepared for Enc	STP	Stripped
Tile	Tile (testing suggested)	☒	Component Does Not Exist	VR/MR	Vinyl/Metal Rep Window
VB	Vinyl Baseboard				
VR	Vinyl Rep Window				

Number of Rooms in Unit 9

Property Type
☒ Single Family
☐ Multi Family # of Units _____
☐ Condominium # of Units _____
☐ Day Care ☐ Other _____

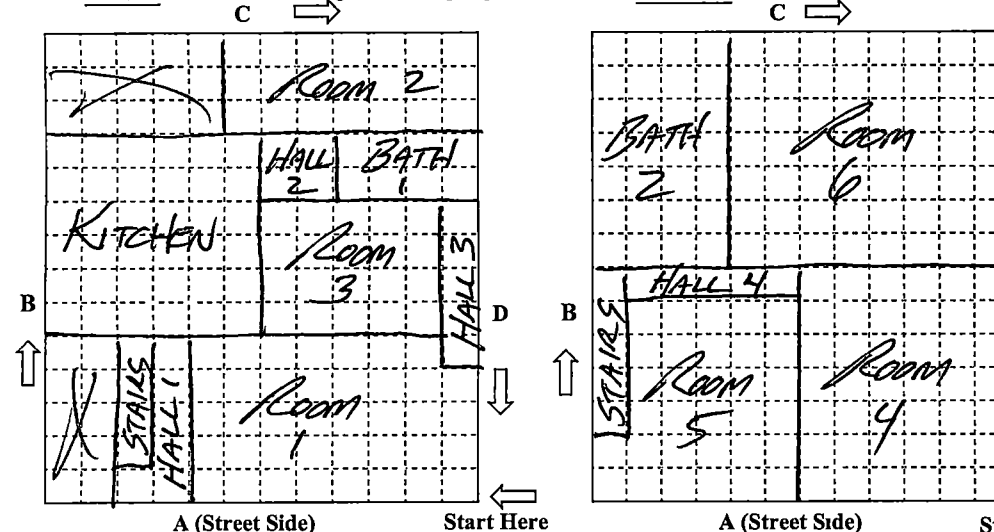
Laundry in Basement? ☒ Yes ☐ No
 Finished Space in Basement? ☐ Yes ☒ No

Possible Pb Water Service Line
☐ Yes ☒ No ☐ Not Tested

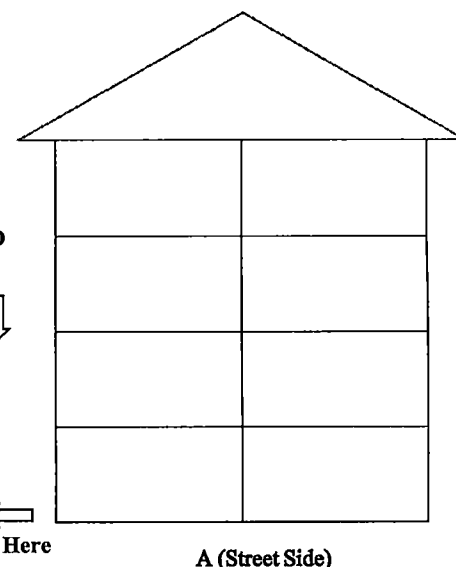
Testing Method Used _____
 Na₂S Expiration Date / /
 X-Ray Fluorescence
 Model RMD LPA1 Serial # 1139

☐ Demarcation Lines
☐ Submitted for Compliance Evaluation

Comments / Notes _____

Floor# 1 (level within building of unit being inspected) Floor# 2

Property Diagram / Unit Labels

Pb (lead) equal to or greater than 1.0 mg/cm² with x-ray fluorescence or positive with Na₂S is **Dangerous.**

XRF Calibration Recorded in Log Book

Address Verified through USPS

Research on Lead Related History for Address

www.state.ma.us/dph/clppp or 800-532-9571



✓ - Check off when complete
 ✓ - Check off when complete
 ✓ - Check off when complete

Craig Anderson

Inspector's Name (print)

LI/RA - revised 06/17

M-3801

License #

Signature

09 / 07 / 22

Date

INSPECTION HISTORY

Determination	☒ Y	Inspector Name: David Carter , Lic# 3134
0 5 2 2 0 2	☐ N	Signature _____
Lead Hazards?		

Comprehensive Initial Inspection	☒ Y	Inspector Name: Craig Anderson , Lic# 3801
0 9 0 7 2 2	☐ N	Signature _____
Lead Hazards?		

Comp Initial w/Partial PCAD	☐ Y	Inspector Name: _____, Lic# _____
	☐ N	Signature _____
Lead Hazards?		

Addendum (add-on to Initial Inspection)	☐ Y	Inspector Name: _____, Lic# _____
	☐ N	Signature _____
Lead Hazards?		

Addendum as Full Inspection	☐ Y	Inspector Name: _____, Lic# _____
	☐ N	Signature _____
Lead Hazards?		

Walk Through for Ed/Consultation		Inspector Name: _____, Lic# _____
		Signature _____

REINSPECTION HISTORY

Visual Portion of Reocc Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Visual Portion of Reocc Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for Reocc Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for Reocc Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Visual Portion of Final Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Visual Portion of Final Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for Final Reinsp (No Reocc)	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for Final Reinsp (No Reocc)	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

INTERIM CONTROL

Visual Risk Assessment	☐ Y	R.A. Name: _____, Lic# _____
	☐ N	Signature _____
Urgent Pb Hazards?		

Dust Taken for Risk Assessment	☐ Y	R.A. Name: _____, Lic# _____
	☐ N	Signature _____
Urgent Pb Hazards?		

Visual Portion of Reinspection for Interim Control	☐ P	R.A. Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for Risk Assessment Reinsp	☐ P	R.A. Name: _____, Lic# _____
	☐ F	Signature _____

Visual Portion of Reinspection for Interim Control	☐ P	R.A. Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for Risk Assessment Reinsp	☐ P	R.A. Name: _____, Lic# _____
	☐ F	Signature _____

Risk Assessment Recertification	☐ Y	R.A. Name: _____, Lic# _____
	☐ N	Signature _____
Urgent Pb Hazards?		

Dust Taken for RA Recertification	☐ P	R.A. Name: _____, Lic# _____
	☐ F	Signature _____

POST COMPLIANCE ASSESSMENT DETERMINATIONS

PCAD	☐ Y	Inspector Name: _____, Lic# _____
	☐ N	Signature _____
Lead Hazards?		

Full Inspection Acting as PCAD	☐ Y	Inspector Name: _____, Lic# _____
	☐ N	Signature _____
Lead Hazards?		

Visual Portion of PCAD Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for PCAD Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

Dust Taken for PCAD Reinspection	☐ P	Inspector Name: _____, Lic# _____
	☐ F	Signature _____

REOCCUPANCY CERTIFICATE HISTORY

Certificate of Reoccupancy				
Only after High/Mod Risk (# rooms rule)				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Reoccupancy				
Only after High/Mod Risk (# rooms rule)				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Reoccupancy				
Only after High/Mod Risk (# rooms rule)				

Inspector Name: _____, Lic# _____

Signature _____

COMPLIANCE HISTORY

Letter of Full Initial Compliance				
No prior history/ No signs of UD				

Inspector Name: _____, Lic# _____

Signature _____

Letter of Interim Control				
No prior Comp Expires in 1 yr				

Inspector Name: _____, Lic# _____

Signature _____

Recertification of Interim Control				
Expires 2 yrs from original Interim Control				

Inspector Name: _____, Lic# _____

Signature _____

Letter of Full Deleading Compliance				
Dust wipes if No Reocc				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Maintained Compliance				
No Work = No Dust Work = 7 Dust				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Restored Compliance				
Dust wipes and auth people				

Inspector Name: _____, Lic# _____

Signature _____

COMPLIANCE HISTORY (CONT.)

Certificate of Maintained Compliance				
No Work = No Dust Work = 7 Dust				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Restored Compliance				
Dust wipes and auth people				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Maintained Compliance				
No Work = No Dust Work = 7 Dust				

Inspector Name: _____, Lic# _____

Signature _____

Certificate of Restored Compliance				
Dust wipes and auth people				

Inspector Name: _____, Lic# _____

Signature _____

OTHER HISTORY: WAIVERS/UD

Approved CLPPP Waiver				
Attach to Comp Docs				

Inspector Name: _____, Lic# _____

Signature _____

Approved CLPPP Waiver				
Attach to Comp Docs				

Inspector Name: _____, Lic# _____

Signature _____

UD / DES Visual Reinspection				
No LOC Issued				

P
F

Inspector Name: _____, Lic# _____

Signature _____

UD / DES Dust Taken				
No LOC Issued				

P
F

Inspector Name: _____, Lic# _____

Signature _____

UD / DES Dust Taken				
No LOC Issued				

P
F

Inspector Name: _____, Lic# _____

Signature _____

UD / DES Final Reinspection				
No LOC Issued				

P
F

Inspector Name: _____, Lic# _____

Signature _____

EXPLANATION OF LEAD INSPECTION / RISK ASSESSMENT REPORT FORM COLUMNS

This page provides general information needed to understand the lead inspection/risk assessment report. However, you should speak with the inspector/risk assessor before you start to do any work on your home.

SIDE	Refers to A, B, C, or D side of the building or room. See the diagram on the cover sheet. The "A" side of the building or room is the side facing the street that gives the property its address (usually, it is the front of the building). Keeping your back to this street, from the "A" side move clockwise to the "B" side on your left, the "C" side opposite you, and the "D" side to the right. Numbering is from left to right.
LOCATION/ SURFACE	Refers to the building component(s) being tested. Some surfaces may be made up of more than one part. For example, "Baseboard" may refer to four separate pieces of wood (one on each wall), but is still considered one surface.
LEAD	The actual lead result. Each surface tested must have a result recorded in the "Lead" column. - A number shows that the surface was tested with an XRF analyzer. A number equal to or greater than 1.0 mg/cm² is a dangerous level of lead. - A "pos" or "neg" shows that the surface was tested with sodium sulfide. "Pos" means that there is a dangerous level of lead. "N/A" means that the inspector was not able to test the surface. The inspector must assume the surface contains lead and require it to be deleaded. Speak to the inspector about possible alternative testing options. "MET" or "MR" means that a metal surface was not tested. Metal handrails, metal window sills, and metal railing caps need to be deleaded if they test equal to or greater than 1.0 mg/cm², or are marked "MET" or "N/A". All other metal surfaces must be intact. - For key to abbreviations like "COV", "VB", "VR" or "MR", "NC", "Tile", "DC", see the cover page.
TYPE OF HAZARD	Not all lead paint must be deleaded. This column tells you IF and WHY a surface needs deleading. The deleading standards below may not apply for Interim Controls. Speak to your risk assessor for more information. "M/I" circled means that the surface is a moveable/impacted part of a window and must be deleaded in its entirety. "SF" circled indicates that there is a storm frame present which requires the blind stop and exterior sill be deleaded as interior moveable / impacted surfaces. "A/M" circled means that the surface is "accessible mouthable" and must be deleaded to a minimum of five feet high, four inches in from the edge or corner. "F" circled means that the surface is a "friction" surface and must be deleaded at all points of potential friction. "L" circled means that the surface is loose and must, at a minimum, be made intact. Loose leaded floors must be sealed with paint or similar coating and pass a dust wipe. - If more than one choice is circled, the rules for deleading may change depending upon what method of deleading you choose. Speak to the inspector for more information. "N/A" means the inspector was unable to determine if the surface was a lead hazard. The person doing the deleading must check this surface and follow all the rules for deleading. Speak to the inspector for more information. - If nothing is circled in the column, then it is likely the surface does not need deleading. Speak to the inspector for more information. Remember, this does not mean the entire surface is lead free, it just does not require deleading in its current condition.
URG HAZ?	This column is completed during a risk assessment, which is an evaluation of a home's suitability for Interim Control. Only a licensed risk assessor can do a risk assessment. If "Y" is circled, then this surface is considered an "Urgent Lead Hazard" and deleading is required to qualify for Interim Control.
IC DATE	The date the licensed risk assessor determines the surface meets the standards for Interim Control.
IC METH	The deleading method or structural repair done to qualify the surface for Interim Control. Refer to the deleading codes key on the cover page.
DELEAD DATE	The date that the lead inspector reinspects the surface and finds that it is in compliance.
DELEAD METH	The method used to bring a surface into full compliance. Refer to codes in the Key on the report's cover page.
EXCLUDED SURFACES	The amount of loose paint on a surface as measured by the lead inspector. "N/A" means that the inspector was not able to measure the loose paint, but has determined it is more than the cut-off for moderate risk making intact.
RULED OUT BOX	Encapsulants only work well if the paint is in good condition. If the inspector sees that there are adhesion problems with eligible surfaces in a room, he/she will rule out encapsulation as a deleading method.

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 5 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property

Apt #

City

ROOM #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	1	L N/A	Y				
A B C D	Baseboards	00	L N/A	Y				
A B C D	Chair Rail	1	L N/A	Y				
A B C D	Radiator	06	L N/A	Y				
	Floor	01	L ☐ (dust) N/A	Y				
	Ceiling	01	L N/A	Y				
A B C D	Door	00	L N/A	Y				
1 2	Door Edge	1	F L N/A	Y				
3 4	Door Casing	01	L N/A	Y				
	Door Jamb	01	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B C D	Door	1	L N/A	Y				
1 2	Door Edge	1	F L N/A	Y				
3 4	Door Casing	01	L N/A	Y				
	Door Jamb	00	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B C D	Door	01	L N/A	Y				
1 2	Door Edge	1	F L N/A	Y				
3 4	Door Casing	01	L N/A	Y				
	Door Jamb	01	F L N/A	Y				
	Threshold	00	L N/A	Y				
A	Closet Door	1	L N/A	Y				
B	CI Door Edge	1	F L N/A	Y				
C	CI Casing	1	L N/A	Y				
D	Closet Jamb	1	F L N/A	Y				
	Closet Walls	1	L N/A	Y				
	CI Baseboard	1	L N/A	Y				
1	Closet Pole	1	L N/A	Y				
2	Closet Shelf	1	L N/A	Y				
3	CI Supports	1	L N/A	Y				
4	Closet Floor	1	L ☐ (dust) N/A	Y				
	Closet Ceiling	1	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ. IN.)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	00	M/I L N/A	Y				
2	Exterior Sill	99	M/I SP L N/A	Y				
3	Part Bead	01	M/I L N/A	Y				
4	Blind Stop	19	M/I SP L N/A	Y				
	Win Ext Sash	00	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	00	M/I L N/A	Y				
2	Exterior Sill	99	M/I SP L N/A	Y				
3	Part Bead	01	M/I L N/A	Y				
4	Blind Stop	12	M/I SP L N/A	Y				
	Win Ext Sash	00	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	99	M/I SP L N/A	Y				
3	Part Bead	00	M/I L N/A	Y				
4	Blind Stop	15	M/I SP L N/A	Y				
	Win Ext Sash	01	M/I L N/A	Y				
A B	Fireplace	1	L N/A	Y				
C D	Mantle	1	L N/A	Y				
A B C D	Win Above 5'	1	L N/A	Y				
	Ceiling Molding	1	L N/A	Y				
A	STORM	1	F M/I A/M L N/A	Y				
	FRAMES	19	F M/I A/M L N/A	Y				
B D	RAD COVER	01	F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

9/2/22

Page 6 Of 29

Inspector (print)

Lic #

Signature

Date

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 90 MAIN ST

Apt #

City ACTON

CONTINUATION OF ROOM (1) (2 of 2)

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
(A)	Window Sill	02	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
#	Win Int Sash	00	M/I L N/A	Y				
4	Exterior Sill	99	M/I SF L N/A	Y				
	Part Bead	01	M/I L N/A	Y				
	Blind Stop	10	M/I SF L N/A	Y				
	Win Ext Sash	01	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
(B)	Win Apron	00	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
#	Win Int Sash	01	M/I L N/A	Y				
1	Exterior Sill	99	M/I SF L N/A	Y				
	Part Bead	00	M/I L N/A	Y				
	Blind Stop	10	M/I SF L N/A	Y				
	Win Ext Sash	02	M/I L N/A	Y				
A	Window Sill	01	M/I A/M L N/A	Y				
(B)	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	00	M/I L N/A	Y				
2	Exterior Sill	99	M/I SF L N/A	Y				
	Part Bead	00	M/I L N/A	Y				
	Blind Stop	13	M/I SF L N/A	Y				
	Win Ext Sash	01	M/I L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
(D)	Header Stop	01	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	00	M/I L N/A	Y				
1	Exterior Sill	N/A	M/I SF L N/A	Y				
	Part Bead	N/A	M/I L N/A	Y				
	Blind Stop	N/A	M/I SF L N/A	Y				
	Win Ext Sash	N/A	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	01	L N/A	Y				
(D)	Header Stop	01	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	00	M/I L N/A	Y				
2	Exterior Sill	99	M/I SF L N/A	Y				
	Part Bead	01	M/I L N/A	Y				
	Blind Stop	19	M/I SF L N/A	Y				
	Win Ext Sash	00	M/I L N/A	Y				
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	00	M/I L N/A	Y				
	Exterior Sill	99	M/I SF L N/A	Y				
	Part Bead	00	M/I L N/A	Y				
	Blind Stop	19	M/I SF L N/A	Y				
	Win Ext Sash	01	M/I L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Date _____

Date _____

Date _____

City

Rear Floor #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Closet Door	/	L N/A	Y				
	CI Door Edge	/	F L N/A	Y				
	CI Casing	/	L N/A	Y				
	Closet Jamb	/	F L N/A	Y				
	Closet Walls	/	L N/A	Y				
	CI Baseboard	/	L N/A	Y				
	Closet Pole	/	L N/A	Y				
	Closet Shelf	/	L N/A	Y				
	CI Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	02	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Extensor Sill	99	M/I SF L N/A	Y				
3	Part Bead	01	M/I L N/A	Y				
4	Blind Stop	56	M/I SF L N/A	Y				
	Win Ext Sash	02	M/I L N/A	Y				
A	Window Sill	/	M/I A/M L N/A	Y				
B	Win Apron	/	L N/A	Y				
C	Win Casing	/	L N/A	Y				
D	Header Stop	/	M/I L N/A	Y				
	Int Stops	/	M/I L N/A	Y				
1	Win Int Sash	/	M/I L N/A	Y				
2	Extensor Sill	/	M/I SF L N/A	Y				
3	Part Bead	/	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
AB CD	Win Above 5'	/	L N/A	Y				
***	Ceiling Molding	/	L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

--	--

LI/RA Rep 2017 Hall

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 8 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property

90 MAIN ST

Apt #

City

ACTON

KITCHEN

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	04 TILE	L N/A	Y				
A B C D	Baseboards	01	L N/A	Y				
A B C D	Chair Rail	1	L N/A	Y				
A B C D	Radiator	1	L N/A	Y				
	Floor	1	L ☐ (dust) N/A	Y				
	Ceiling	00	L N/A	Y				
A B C D	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B C D	Door	01	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	02	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B C D	Door	00	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	03	F L N/A	Y				
	Threshold	0.1	L N/A	Y				
	Closet Door	1	L N/A	Y				
A	Cl Door Edge	1	F L N/A	Y				
B	Cl Casing	1	L N/A	Y				
C	Closet Jamb	1	F L N/A	Y				
D	Closet Walls	1	L N/A	Y				
	Cl Baseboard	1	L N/A	Y				
1	Closet Pole	1	L N/A	Y				
2	Closet Shelf	1	L N/A	Y				
3	Cl Supports	1	L N/A	Y				
4	Closet Floor	1	L ☐ (dust) N/A	Y				
	Closet Ceiling	1	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	1	M/I L N/A	Y				
2	Exterior Sill	1	M/I SF L N/A	Y				
3	Part Bead	1	M/I L N/A	Y				
4	Blind Stop	1	M/I SF L N/A	Y				
	Win Ext Sash	1	M/I L N/A	Y				
A	Window Sill	1	M/I A/M L N/A	Y				
B	Win Apron	1	L N/A	Y				
C	Win Casing	1	L N/A	Y				
D	Header Stop	1	M/I L N/A	Y				
	Int Stops	1	M/I L N/A	Y				
1	Win Int Sash	1	M/I L N/A	Y				
2	Exterior Sill	1	M/I SF L N/A	Y				
3	Part Bead	1	M/I L N/A	Y				
4	Blind Stop	1	M/I SF L N/A	Y				
	Win Ext Sash	1	M/I L N/A	Y				
A B C D	Up Cab Frame	00	L N/A	Y				
C D	Up Cab Door	00	L N/A	Y				
	Up Cab Walls	01	L N/A	Y				
1 2	Up Cab Shlvs	00	L N/A	Y				
3 4	Supports	1	L N/A	Y				
	Low Cab Fram	01	L N/A	Y				
A B C D	Low Cab Door	01	L N/A	Y				
C D	Low Cab Walls	00	L N/A	Y				
	Low Cab Shlvs	00	L N/A	Y				
1 2	Supports	1	L N/A	Y				
3 4	Drawers	00	L N/A	Y				
A B C D	Win Above 5'	1	L N/A	Y				
	Ceiling Molding	1	L N/A	Y				
D	Door	1	F M/I A/M L N/A	Y				
	CASING	01	F M/I A/M L N/A	Y				
	JAMB	01	F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 9 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property

Apt #

City

ROOM #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	02	L N/A	Y				
A B C D	Low Walls	/	L N/A	Y				
A B C D	Baseboards	01	L N/A	Y				
A B C D	Chair Rail	/	L N/A	Y				
A B C D	Radiator	08	L N/A	Y				
	Floor	01	L ☐ (dust) N/A	Y				
	Ceiling	01	L N/A	Y				
A B C D	Door	/	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	00	L N/A	Y				
	Door Jamb	01	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	00	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	00	L N/A	Y				
	Door Jamb	01	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	01	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	00	L N/A	Y				
	Door Jamb	00	F L N/A	Y				
	Threshold	01	L N/A	Y				
A	Closet Door	00	L N/A	Y				
B	CI Door Edge	/	F L N/A	Y				
C	CI Casing	01	L N/A	Y				
D	Closet Jamb	01	F L N/A	Y				
	Closet Walls	00	L N/A	Y				
	CI Baseboard	00	L N/A	Y				
1	Closet Pole	01	L N/A	Y				
2	Closet Shelf	01	L N/A	Y				
3	CI Supports	00	L N/A	Y				
4	Closet Floor	01	L ☐ (dust) N/A	Y				
	Closet Ceiling	02	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
A B	Fireplace	/	L N/A	Y				
C D	Mantle	/	L N/A	Y				
A B C D	Win Above 5'	/	L N/A	Y				
	Ceiling Molding	/	L N/A	Y				
C	BENCH	00	F M/I A/M L N/A	Y				
	DRAWERS	00	F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

☐ Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 10 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property

90 MAIN ST

Apt #

City

Acton

CONTINUATION OF ROOM

(2) (2 of 2)

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	01	M/I L N/A	Y				
2	Extensor Sill	1/4	M/I SF L N/A	Y				
	Part Bead	1/4	M/I L N/A	Y				
	Blind Stop	1/4	M/I SF L N/A	Y				
	Win Ext Sash	1/4	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	01	M/I L N/A	Y				
3	Extensor Sill	1/4	M/I SF L N/A	Y				
	Part Bead	1/4	M/I L N/A	Y				
	Blind Stop	1/4	M/I SF L N/A	Y				
	Win Ext Sash	1/4	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
#	Win Int Sash	00	M/I L N/A	Y				
4	Extensor Sill	1/4	M/I SF L N/A	Y				
	Part Bead	1/4	M/I L N/A	Y				
	Blind Stop	1/4	M/I SF L N/A	Y				
	Win Ext Sash	1/4	M/I L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	02	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
#	Win Int Sash	01	M/I L N/A	Y				
1	Extensor Sill	1/4	M/I SF L N/A	Y				
	Part Bead	1/4	M/I L N/A	Y				
	Blind Stop	1/4	M/I SF L N/A	Y				
	Win Ext Sash	1/4	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
#	Win Int Sash	01	M/I L N/A	Y				
2	Extensor Sill	1/4	M/I SF L N/A	Y				
	Part Bead	1/4	M/I L N/A	Y				
	Blind Stop	1/4	M/I SF L N/A	Y				
	Win Ext Sash	1/4	M/I L N/A	Y				
A	Window Sill	1	M/I A/M L N/A	Y				
B	Win Apron	1	L N/A	Y				
C	Win Casing	1	L N/A	Y				
D	Header Stop	1	M/I L N/A	Y				
	Int Stops	1	M/I L N/A	Y				
#	Win Int Sash	1	M/I L N/A	Y				
	Extensor Sill	1	M/I SF L N/A	Y				
	Part Bead	1	M/I L N/A	Y				
	Blind Stop	1	M/I SF L N/A	Y				
	Win Ext Sash	1	M/I L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

9/2/22

Page 11 of 29

Inspector (print)

Lic #

Signature

Date

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 90 MAIN ST

Apt #

City ACTON

HALLWAY Interior # 2 or Common Hallway Front Rear Floor #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Walls	00	L N/A	Y				
A B C D	Low Walls	12	L N/A	Y				
A B C D	Baseboards	01	L N/A	Y				
A B C D	Chair Rail	/	L N/A	Y				
A B C D	Radiator	/	L N/A	Y				
	Floor	00	L ☐ (dust) N/A	Y				
	Ceiling	02	L N/A	Y				
A B C D	Door	/	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	/	L N/A	Y				
	Door Jamb	00	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	01	L N/A	Y				
	Door Jamb	00	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B C D	Door	00	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	00	L N/A	Y				
	Door Jamb	01	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B C D	Door	/	L N/A	Y				
1 2	Door Edge	/	F L N/A	Y				
3 4	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A	Closet Door	/	L N/A	Y				
B	CI Door Edge	/	F L N/A	Y				
C	Closet Casing	/	L N/A	Y				
D	Closet Jamb	/	F L N/A	Y				
	Closet Walls	/	L N/A	Y				
	CI Baseboard	/	L N/A	Y				
1	Closet Pole	/	L N/A	Y				
2	Closet Shelf	/	L N/A	Y				
3	CI Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
	Closet Door	/	L N/A	Y				
A	CI Door Edge	/	F L N/A	Y				
B	CI Casing	/	L N/A	Y				
C	Closet Jamb	/	F L N/A	Y				
D	Closet Walls	/	L N/A	Y				
	CI Baseboard	/	L N/A	Y				
1	Closet Pole	/	L N/A	Y				
2	Closet Shelf	/	L N/A	Y				
3	CI Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				
A	Window Sill	/	M/I A/M L N/A	Y				
B	Win Apron	/	L N/A	Y				
C	Win Casing	/	L N/A	Y				
D	Header Stop	/	M/I L N/A	Y				
	Int Stops	/	M/I L N/A	Y				
1	Win Int Sash	/	M/I L N/A	Y				
2	Exterior Sill	/	M/I SF L N/A	Y				
3	Part Bead	/	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A	Window Sill	/	M/I A/M L N/A	Y				
B	Win Apron	/	L N/A	Y				
C	Win Casing	/	L N/A	Y				
D	Header Stop	/	M/I L N/A	Y				
	Int Stops	/	M/I L N/A	Y				
1	Win Int Sash	/	M/I L N/A	Y				
2	Exterior Sill	/	M/I SF L N/A	Y				
3	Part Bead	/	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A B C D	Win Above 5'	/	L N/A	Y				
	Ceiling Molding	/	L N/A	Y				
B	SHELVES	00	F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 12 of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property

Apt #

City

BATHROOM #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	01	L N/A	Y				
A B C D	Baseboards	02	L N/A	Y				
A B C D	Chair Rail	01	L N/A	Y				
A B C D	Radiator	01	L N/A	Y				
	Floor	01	L ☐ (dust) N/A	Y				
	Ceiling	01	L N/A	Y				
A B C D	Door	00	L N/A	Y				
C D	Door Edge	01	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B	Door	01	L N/A	Y				
C D	Door Edge	01	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B	Door	01	L N/A	Y				
C D	Door Edge	01	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	01	L N/A	Y				
	Closet Door	01	L N/A	Y				
A	Cl Door Edge	01	F L N/A	Y				
B	Cl Casing	01	L N/A	Y				
C	Closet Jamb	01	F L N/A	Y				
D	Closet Walls	01	L N/A	Y				
	Cl Baseboard	01	L N/A	Y				
1	Closet Pole	01	L N/A	Y				
2	Closet Shelf	01	L N/A	Y				
3	Cl Supports	01	L N/A	Y				
4	Closet Floor	01	L ☐ (dust) N/A	Y				
	Closet Ceiling	01	L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Up Cab Frame	00	L N/A	Y				
C D	Up Cab Door	00	L N/A	Y				
	Up Cab Walls	01	L N/A	Y				
1 2	Up Cab Shlvs	01	L N/A	Y				
3 4	Supports	01	L N/A	Y				
	Low Cab Fram	01	L N/A	Y				
A B	Low Cab Door	00	L N/A	Y				
C D	Low Cab Walls	01	L N/A	Y				
	Low Cab Shlvs	01	L N/A	Y				
1 2	Supports	01	L N/A	Y				
3 4	Drawers	01	L N/A	Y				
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	01	M/I SF L N/A	Y				
3	Part Bead	01	M/I L N/A	Y				
4	Blind Stop	01	M/I SF L N/A	Y				
	Win Ext Sash	01	M/I L N/A	Y				
A B C D	Win Above 5'	01	L NA	Y				
	Ceiling Molding	01	L NA	Y				
A B C D	Medicine Cab	01	L NA	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				
		01	F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 13 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 90 MAIN ST

Apt #

City

ACTON

ROOM # 3

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	01	L N/A	Y				
A B C D	Low Walls	/	L N/A	Y				
A B C D	Baseboards	00	L N/A	Y				
A B C D	Chair Rail	/	L N/A	Y				
A B C D	Radiator	14	L N/A	Y				
	Floor	0.1	L ☐ (dust) N/A	Y				
	Ceiling	01	L N/A	Y				
A B	Door	/	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	00	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B	Door	/	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	00	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B	Door	/	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A	Closet Door	/	L N/A	Y				
B	CI Door Edge	/	F L N/A	Y				
C	CI Casing	/	L N/A	Y				
D	Closet Jamb	/	F L N/A	Y				
	Closet Walls	/	L N/A	Y				
	CI Baseboard	/	L N/A	Y				
1	Closet Pole	/	L N/A	Y				
2	Closet Shelf	/	L N/A	Y				
3	CI Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	02	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	0.1	M/I L N/A	Y				
2	Exterior Sill	04	M/I SF L N/A	Y				
3	Part Bead	02	M/I L N/A	Y				
4	Blind Stop	16	M/I SF L N/A	Y				
	Win Ext Sash	0.1	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	0.1	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	NA	M/I SF L N/A	Y				
3	Part Bead	NA	M/I L N/A	Y				
4	Blind Stop	NA	M/I SF L N/A	Y				
	Win Ext Sash	NA	M/I L N/A	Y				
A	Window Sill	.	M/I A/M L N/A	Y				
B	Win Apron	.	L N/A	Y				
C	Win Casing	.	L N/A	Y				
D	Header Stop	.	M/I L N/A	Y				
	Int Stops	.	M/I L N/A	Y				
1	Win Int Sash	.	M/I L N/A	Y				
2	Exterior Sill	.	M/I SF L N/A	Y				
3	Part Bead	.	M/I L N/A	Y				
4	Blind Stop	.	M/I SF L N/A	Y				
	Win Ext Sash	.	M/I L N/A	Y				
A B	Fireplace	.	L N/A	Y				
C D	Mantle	.	L N/A	Y				
A B C D	Win Above 5'	.	L N/A	Y				
	Ceiling Molding	.	L N/A	Y				
		.	F M/I A/M L N/A	Y				
		.	F M/I A/M L N/A	Y				
		.	F M/I A/M L N/A	Y				
		.	F M/I A/M L N/A	Y				
		.	F M/I A/M L N/A	Y				
		.	F M/I A/M L N/A	Y				

☐ Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

M-3801

Inspector (print)

Lic #

~~Signature~~

Date _____

Page 14 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date _____

Address of Property 90 Main St

Apt #

City

HALLWAY Interior # 3 or Common Hallway Front Rear Floor # _____

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	/	L N/A	Y				
A B C D	Baseboards	01	L N/A	Y				
A B C D	Chair Rail	/	L N/A	Y				
A B C D	Radiator	/	L N/A	Y				
	Floor	00	L ☐ (dust) N/A	Y	TILE			
	Ceiling	01	L N/A	Y				
A B C D	Door	00	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	16	F L N/A	Y				
	Threshold	00	L N/A	Y				
A B C D	Door	00	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	N/A	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ. IN.)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Closet Door		L N/A	Y				
	Cl Door Edge		F L N/A	Y				
	Cl Casing		L N/A	Y				
	Closet Jamb		F L N/A	Y				
	Closet Walls		L N/A	Y				
	Cl Baseboard		L N/A	Y				
	Closet Pole		L N/A	Y				
	Closet Shelf		L N/A	Y				
	Cl Supports		L N/A	Y				
4	Closet Floor		L ☐ (dust) N/A	Y				
	Closet Ceiling		L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y	TILE			
B	Win Apron		L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
A	Window Sill	01	M/I A/M L N/A	Y	TILE			
B	Win Apron		L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop		M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
AB CD	Win Above 5'		L N/A	Y				
	Ceiling Molding		L N/A	Y				
B	TREADS	00	F M/I A/M L N/A	Y				
	RISERS	05	F M/I A/M L N/A	Y	TILE			
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

10

Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 15 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property

Apt #

City

STAIRCASE #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	1	L N/A	Y				
A B C D	Baseboards	01	L N/A	Y				
A B C D	Chair Rail	1	L N/A	Y				
A B C D	Radiator	1	L N/A	Y				
	Floor	01	L ☐ (dust) N/A	Y				
	Ceiling	03	L N/A	Y				
A B	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	1	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	1	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	1	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	1	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
A	Closet Door	1	L N/A	Y				
B	Cl Door Edge	1	F L N/A	Y				
C	Cl Casing	1	L N/A	Y				
D	Closet Jamb	1	F L N/A	Y				
	Closet Walls	1	L N/A	Y				
	Cl Baseboard	1	L N/A	Y				
1	Closet Pole	1	L N/A	Y				
2	Closet Shelf	1	L N/A	Y				
3	Cl Supports	1	L N/A	Y				
4	Closet Floor	1	L ☐ (dust) N/A	Y				
	Closet Ceiling	1	L N/A	Y				

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	00	M/I A/M L N/A	Y	FL 2			
B	Win Apron	00	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	99	M/I SF L N/A	Y				
3	Part Bead	00	M/I L N/A	Y				
4	Blind Stop	99	M/I SF L N/A	Y				
	Win Ext Sash	01	M/I L N/A	Y				
A	Window Sill	1	M/I A/M L N/A	Y				
B	Win Apron	1	L N/A	Y				
C	Win Casing	1	L N/A	Y				
D	Header Stop	1	M/I L N/A	Y				
	Int Stops	1	M/I L N/A	Y				
1	Win Int Sash	1	M/I L N/A	Y				
2	Exterior Sill	1	M/I SF L N/A	Y				
3	Part Bead	1	M/I L N/A	Y				
4	Blind Stop	1	M/I SF L N/A	Y				
	Win Ext Sash	1	M/I L N/A	Y				
	Newel Post	01	L N/A	Y				
	Railing Cap	00	A/M L N/A	Y				
	Handrail	1	A/M L N/A	Y				
	Balusters	00	L N/A	Y				
	Lower rail	1	L N/A	Y				
	Treads	01	F L N/A	Y				
	Risers	00	L N/A	Y				
	Stringer	01	L N/A	Y				
	Tread edge >5	01	L N/A	Y				
	Landing floor	00	L ☐ (dust) N/A	Y				
	Floor Edge	1	L N/A	Y				
	Floor Casing	1	L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

9/7/22

Page 16 Of 29

Inspector (print)

Lic #

Signature

Date

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 90 Main St

Apt #

City Acton

HALLWAY Interior # 4 or Common Hallway Front Rear Floor #

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	01	L N/A	Y				
A B C D	Low Walls	/	L N/A	Y				
A B C D	Baseboards	00	L N/A	Y				
A B C D	Chair Rail	/	L N/A	Y				
A B C D	Radiator	/	L N/A	Y				
	Floor	01	L ☐ (dust) N/A	Y				
	Ceiling	00	L N/A	Y				
A B C D	Door	00	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	01	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B C D	Door	01	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	00	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B C D	Door	00	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	02	F L N/A	Y				
	Closet Door	/	L N/A	Y				
A	CI Door Edge	/	F L N/A	Y				
B	CI Casing	/	L N/A	Y				
C	Closet Jamb	/	F L N/A	Y				
D	Closet Walls	/	L N/A	Y				
	CI Baseboard	/	L N/A	Y				
1	Closet Pole	/	L N/A	Y				
2	Closet Shelf	/	L N/A	Y				
3	CI Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
	Closet Door	/	L N/A	Y				
A	CI Door Edge	/	F L N/A	Y				
B	CI Casing	/	L N/A	Y				
C	Closet Jamb	/	F L N/A	Y				
D	Closet Walls	/	L N/A	Y				
	CI Baseboard	/	L N/A	Y				
1	Closet Pole	/	L N/A	Y				
2	Closet Shelf	/	L N/A	Y				
3	CI Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				
A	Window Sill	/	M/I A/M L N/A	Y				
B	Win Apron	/	L N/A	Y				
C	Win Casing	/	L N/A	Y				
D	Header Stop	/	M/I L N/A	Y				
	Int Stops	/	M/I L N/A	Y				
1	Win Int Sash	/	M/I L N/A	Y				
2	Exterior Sill	/	M/I SF L N/A	Y				
3	Part Bead	/	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A	Window Sill	/	M/I A/M L N/A	Y				
B	Win Apron	/	L N/A	Y				
C	Win Casing	/	L N/A	Y				
D	Header Stop	/	M/I L N/A	Y				
	Int Stops	/	M/I L N/A	Y				
1	Win Int Sash	/	M/I L N/A	Y				
2	Exterior Sill	/	M/I SF L N/A	Y				
3	Part Bead	/	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A B C D	Win Above 5'	/	L N/A	Y				
	Ceiling Molding	/	L N/A	Y				
C3	Door	01	F M/I A/M L N/A	Y				
	CASING	00	F M/I A/M L N/A	Y				
	JAMB	01	F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE	LOOSE PAINT	IC DATE	IC METHOD



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 18 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 90 Main St

Apt #

City Acton

ROOM # 5

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	1	L N/A	Y				
A B C D	Baseboards	0.2	L N/A	Y				
A B C D	Chair Rail	1	L N/A	Y				
A B C D	Radiator	06	L N/A	Y				
	Floor	01	L ☐ (dust) N/A	Y				
	Ceiling	00	L N/A	Y				
A B C D	Door	21	L N/A	Y				
1 2 3 4	Door Edge	1	F L N/A	Y				
	Door Casing	01	L N/A	Y				
	Door Jamb	00	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B C D	Door	01	L N/A	Y				
1 2 3 4	Door Edge	1	F L N/A	Y				
	Door Casing	00	L N/A	Y				
	Door Jamb	01	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B C D	Door	1	L N/A	Y				
1 2 3 4	Door Edge	1	F L N/A	Y				
	Door Casing	1	L N/A	Y				
	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
	Closet Door	00	L N/A	Y				
A B C D	CI Door Edge	1	F L N/A	Y				
	CI Casing	01	L N/A	Y				
	Closet Jamb	00	F L N/A	Y				
	Closet Walls	01	L N/A	Y				
	CI Baseboard	01	L N/A	Y				
1 2 3 4	Closet Pole	02	L N/A	Y				
	Closet Shelf	00	L N/A	Y				
	CI Supports	00	L N/A	Y				
	Closet Floor	01	L ☐ (dust) N/A	Y				
	Closet Ceiling	0.1	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Window Sill	15	M/I A/M L N/A	Y				
	Win Apron	1.2	L N/A	Y				
	Win Casing	2.5	L N/A	Y				
	Header Stop	0.2	M/I L N/A	Y				
	Int Stops	0.1	M/I L N/A	Y				
1 2 3 4	Win Int Sash	17	M/I L N/A	Y				
	Exterior Sill	12	M/I SF L N/A	Y				
	Part Bead	0.1	M/I L N/A	Y				
	Blind Stop	10	M/I SF L N/A	Y				
	Win Ext Sash	19	M/I L N/A	Y				
A B C D	Window Sill	18	M/I A/M L N/A	Y				
	Win Apron	12	L N/A	Y				
	Win Casing	20	L N/A	Y				
	Header Stop	0.1	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1 2 3 4	Win Int Sash	25	M/I L N/A	Y				
	Exterior Sill	1.1	M/I SF L N/A	Y				
	Part Bead	0.2	M/I L N/A	Y				
	Blind Stop	10	M/I SF L N/A	Y				
	Win Ext Sash	23	M/I L N/A	Y				
A B C D	Window Sill	1	M/I A/M L N/A	Y				
	Win Apron	1	L N/A	Y				
	Win Casing	1	L N/A	Y				
	Header Stop	1	M/I L N/A	Y				
	Int Stops	1	M/I L N/A	Y				
1 2 3 4	Win Int Sash	1	M/I L N/A	Y				
	Exterior Sill	1	M/I SF L N/A	Y				
	Part Bead	1	M/I L N/A	Y				
	Blind Stop	1	M/I SF L N/A	Y				
	Win Ext Sash	1	M/I L N/A	Y				
A B C D	Fireplace	1	L N/A	Y				
	Mantle	1	L N/A	Y				
A B C D	Win Above 5'	1	L N/A	Y				
	Ceiling Molding	1	L N/A	Y				
	B BENCH	02	F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 19 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property 90 MAIN ST

Apt #

City ACTON

BATHROOM # 2

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	00	L N/A	Y				
A B C D	Low Walls	1	L N/A	Y				
A B C D	Baseboards	01	L N/A	Y				
A B C D	Chair Rail	1	L N/A	Y				
A B C D	Radiator	1.1	L N/A	Y				
A B C D	Floor	00	L ☐ (dust) N/A	Y				
A B C D	Ceiling	00	L N/A	Y				
A B C D	Door	00	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	00	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	1	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
A B	Door	1	L N/A	Y				
C D	Door Edge	1	F L N/A	Y				
1 2	Door Casing	1	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
A	Closet Door	1	L N/A	Y				
A	Cl Door Edge	1	F L N/A	Y				
B	Cl Casing	1	L N/A	Y				
C	Closet Jamb	1	F L N/A	Y				
D	Closet Walls	1	L N/A	Y				
	Cl Baseboard	1	L N/A	Y				
1	Closet Pole	1	L N/A	Y				
2	Closet Shelf	1	L N/A	Y				
3	Cl Supports	1	L N/A	Y				
4	Closet Floor	1	L ☐ (dust) N/A	Y				
	Closet Ceiling	1	L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Up Cab Frame	1	L N/A	Y				
C D	Up Cab Door	1	L N/A	Y				
	Up Cab Walls	1	L N/A	Y				
1 2	Up Cab Shlvs	1	L N/A	Y				
3 4	Supports	1	L N/A	Y				
	Low Cab Fram	00	L N/A	Y				
A B	Low Cab Door	00	L N/A	Y				
C D	Low Cab Walls	00	L N/A	Y				
	Low Cab Shlvs	1	L N/A	Y				
1 2	Supports	1	L N/A	Y				
3 4	Drawers	0.1	L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	01	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	00	M/I L N/A	Y				
	Int Stops	01	M/I L N/A	Y				
1	Win Int Sash	00	M/I L N/A	Y				
2	Exterior Sill	NA M/I SF	L N/A	Y				
3	Part Bead	NA M/I	L N/A	Y				
4	Blind Stop	NA M/I SF	L N/A	Y				
	Win Ext Sash	NA M/I	L N/A	Y				
A B C D	Win Above 5'	1	L NA	Y				
	Ceiling Molding	1	L NA	Y				
A B C D	Medicine Cab	00	L NA	Y				
	Shower	1	F M/I A/M L N/A	Y				
	Tile	00	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				
		1	F M/I A/M L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 20 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 30 MAIN ST

Apt #

City ACTON

ROOM # 6

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Up Walls	02	L N/A	Y				
A B C D	Low Walls	/	L N/A	Y				
A B C D	Baseboards	00	L N/A	Y				
A B C D	Chair Rail	/	L N/A	Y				
A B C D	Radiator	08	L N/A	Y				
	Floor	21	L ☐ (dust) N/A	Y				
	Ceiling	21	L N/A	Y				
A B	Door	00	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	21	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B	Door	01	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	21	F L N/A	Y				
	Threshold	/	L N/A	Y				
A B	Door	/	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Closet Door	21	L N/A	Y				
A	CI Door Edge	/	F L N/A	Y				
B	CI Casing	01	L N/A	Y				
C	Closet Jamb	00	F L N/A	Y				
D	Closet Walls	21	L N/A	Y				
	CI Baseboard	21	L N/A	Y				
1	Closet Pole	00	L N/A	Y				
2	Closet Shelf	00	L N/A	Y				
3	CI Supports	01	L N/A	Y				
4	Closet Floor	21	L ☐ (dust) N/A	Y				
	Closet Ceiling	00	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	01	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	00	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
A	Window Sill	00	M/I A/M L N/A	Y				
B	Win Apron	00	L N/A	Y				
C	Win Casing	01	L N/A	Y				
D	Header Stop	01	M/I L N/A	Y				
	Int Stops	00	M/I L N/A	Y				
1	Win Int Sash	01	M/I L N/A	Y				
2	Exterior Sill	VA	M/I SF L N/A	Y				
3	Part Bead	VA	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	VA	M/I L N/A	Y				
A	Window Sill	/	M/I A/M L N/A	Y				
B	Win Apron	/	L N/A	Y				
C	Win Casing	/	L N/A	Y				
D	Header Stop	/	M/I L N/A	Y				
	Int Stops	/	M/I L N/A	Y				
1	Win Int Sash	/	M/I L N/A	Y				
2	Exterior Sill	/	M/I SF L N/A	Y				
3	Part Bead	/	M/I L N/A	Y				
4	Blind Stop	/	M/I SF L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A B	Fireplace	/	L N/A	Y				
C D	Mantle	/	L N/A	Y				
A B C D	Win Above 5'	/	L N/A	Y				
	Ceiling Molding	/	L N/A	Y				
B	SHELVES	01	F M/I A/M L N/A	Y				
	SUPPORTS	00	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

9/7/22

Page 21 Of 29

Inspector (print)

Lic #

Signature

Date

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property 90 MAIN ST

Apt #

City ACTON

BASEMENT/LAUNDRY AREA

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Walls	00	L N/A	Y	ON STAIRS			
A B C D	Walls	04	L N/A	Y	FOUNDATION			
A B C D	Walls	/	L N/A	Y				
A B C D	Walls	/	L N/A	Y				
A B C D	Baseboards	02	L N/A	Y	BEAMS ON STAIRS			
A B C D	Chair rails	/	L N/A	Y				
	Floor	NC	L ☐ (dust) N/A	Y				
	Ceiling	01	L N/A	Y				
A B C D	Chimney	NC	L N/A	Y				
A B C D	Support Column	06	L N/A	Y				
A B	Door FL	01	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	00	F L N/A	Y				
	Threshold	01	L N/A	Y				
A B	Door	/	L N/A	Y				
C D	Door Edge	/	F L N/A	Y				
1 2	Door Casing	/	L N/A	Y				
3 4	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
A	Closet Door	/	L N/A	Y				
B	Cl Door Edge	/	F L N/A	Y				
C	Cl Casing	/	L N/A	Y				
D	Closet Jamb	/	F L N/A	Y				
	Closet Walls	/	L N/A	Y				
	Cl Baseboard	/	L N/A	Y				
1	Closet Pole	/	L N/A	Y				
2	Closet Shelf	/	L N/A	Y				
3	Cl Supports	/	L N/A	Y				
4	Closet Floor	/	L ☐ (dust) N/A	Y				
	Closet Ceiling	/	L N/A	Y				
A B C D	Cabinets	/	L N/A	Y				
A B	Benches	/	L N/A	Y				
C D	Supports	/	L N/A	Y				
A B C D	Pipes	05	L N/A	Y				
A B C D	Sink	/	L N/A	Y				
A B C D	Drainpipe	NC	L N/A	Y				

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 288 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B C D	Serviceboard	/	L N/A	Y				
A B	Shelves	/	L N/A	Y				
C D	Supports	/	L N/A	Y				
A B	Shelves	/	L N/A	Y				
C D	Supports	/	L N/A	Y				
A B	Shelves	/	L N/A	Y				
C D	Supports	/	L N/A	Y				
A B	Window frame	01	M/I L N/A	Y				
C D	Window Sash	00	M/I L N/A	Y				
1 2	Exterior Sill	/	M/I L N/A	Y				
3 4	Part Bead	/	M/I L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A B	Window frame	00	M/I L N/A	Y				
C D	Window Sash	00	M/I L N/A	Y				
1 2	Exterior Sill	/	M/I L N/A	Y				
3 4	Part Bead	/	M/I L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
A B	Window frame	/	M/I L N/A	Y				
C D	Window Sash	/	M/I L N/A	Y				
1 2	Exterior Sill	/	M/I L N/A	Y				
3 4	Part Bead	/	M/I L N/A	Y				
	Win Ext Sash	/	M/I L N/A	Y				
	Newel Posts	01	L N/A	Y				
A B	Handrail	01	A/M L N/A	Y				
C D	Balusters	/	L N/A	Y				
1 2	Lower rail	/	L N/A	Y				
3 4	Treads	00	F L N/A	Y				
	Risers	01	L N/A	Y				
	Stringer	01	L N/A	Y				
	Tread Edge	01	L N/A	Y				
	Landing floor	/	L ☐ (dust) N/A	Y				
A B C D	Oil Tank	/	L N/A	Y				
A B C D	Win Above 5'	/	L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

Comments/Structural Defects



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 22 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date

Address of Property

90 MAIN ST

Apt #

City

ACTON

~~POOR~~

(side)

(floor)

GARAGE INTERIOR

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Siding	01	L N/A	Y				
C D	Corner Boards	1	L N/A	Y				
	Upper Trim	1	L N/A	Y				
	Ceiling	00	L N/A	Y				
	Joists	01	L N/A	Y				
	Storm Door	1	L N/A	Y				
A B	Strm Door Edge	1	F L N/A	Y				
C D	Door	00	L N/A	Y				
	Door Edge	1	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	1	F L N/A	Y				
	Threshold	1	L N/A	Y				
	Kickplate	1	L N/A	Y				
	Storm Door	1	L N/A	Y				
A B	Strm Door Edge	1	F L N/A	Y				
C D	Door	00	L N/A	Y				
	Door Edge	1	F L N/A	Y				
1 2	Door Casing	00	L N/A	Y				
3 4	Door Jamb	00	F L N/A	Y				
	Threshold	NC	L N/A	Y				
	Kickplate	01	L N/A	Y				
A B	Window Sill	99 A/M	L N/A	Y				
C D	Win Casing	19	L N/A	Y				
1 2	Window Sash	02	L N/A	Y				
3 4	Mullions	02	L N/A	Y				
A B	Window Sill	99 A/M	L N/A	Y				
C D	Win Casing	99	L N/A	Y				
1 2	Window Sash	NC	L N/A	Y				
3 4	Mullions	1	L N/A	Y				
A B	Window Sill	1	A/M L N/A	Y				
C D	Win Casing	1	L N/A	Y				
1 2	Window Sash	1	L N/A	Y				
3 4	Mullions	1	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Window Sill	1	A/M L N/A	Y				
C D	Win Casing	1	L N/A	Y				
1 2	Window Sash	1	L N/A	Y				
3 4	Mullions	1	L N/A	Y				
A B	Window Sill	1	A/M L N/A	Y				
C D	Win Casing	1	L N/A	Y				
1 2	Window Sash	1	L N/A	Y				
3 4	Mullions	1	L N/A	Y				
	Support Clms	1	L N/A	Y				
	Newel post	1	L N/A	Y				
	Railing Cap	1	A/M L N/A	Y				
	Handrail	1	A/M L N/A	Y				
	Balusters	1	L N/A	Y				
	Lower Rail	1	L N/A	Y				
	Treads	NC	F L N/A	Y				
	Risers	NC	L N/A	Y				
	Stringer	1	L N/A	Y				
	Tread Edge	1	L N/A	Y				
	Lower Walls	1	L N/A	Y				
	Lattice	1	L N/A	Y				
	Lower Trim	1	L N/A	Y				
	Floor	NC	L (dust)* N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				
			F M/I A/M L N/A	Y				

(dust)* - Applies only to porches used as interior space

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can be made intact only by a licensed deleader

SIDE	LOCATION	MEASURE LOOSE PAINT (MORE THAN 2880 SQ IN)	IC DATE	IC METHOD



Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 24 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property

90 Main St

Apt #

City

Acton

EXTERIOR A Side

SIDE A	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Siding	99	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trm	/	L N/A	Y				
	Upper Trm	N/A	L N/A	Y				
	Win Above 5'	N/A	L N/A	Y				
	Porch Above 5'	/	L N/A	Y				
A	Storm Door	/	L N/A	Y				
	Strm Door Edge	/	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
A	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Storm Door	/	L N/A	Y				
	Strm Door Edge	/	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
A	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
A	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Window Sill	99	L N/A	Y				
	Win Casing	99	L N/A	Y				
A	Window Sash	Cal	L N/A	Y				
	Window Sill	99	L N/A	Y				
	Win Casing	99	L N/A	Y				
	Window Sash	Cal	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 2880 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD
A				
A				
A				
A				

SIDE A	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Window Sill	99	L N/A	Y				
	Win Casing	99	L N/A	Y				
	Window Sash	Cal	L N/A	Y				
	Cellar Win Sill	99	L N/A	Y				
	Cellar Win Frame	99	L N/A	Y				
	Cellar Win Sash	Cal	L N/A	Y				
A	Screen Frame	/	L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Frame	/	L N/A	Y				
	Cel Win Sash	/	L N/A	Y				
	Screen Frame	/	L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
A	Cel Win Frame	/	L N/A	Y				
	Cel Win Sash	/	L N/A	Y				
	Screen Frame	/	L N/A	Y				
	Foundation	/	L N/A	Y				
	Bulkhead	/	L N/A	Y				
	Fences	/	L N/A	Y				
A	Shutters	/	L N/A	Y				
	Newel post	/	L N/A	Y				
	Railing Cap	/	A/M L N/A	Y				
	Handrail	/	A/M L N/A	Y				
	Balusters	/	L N/A	Y				
	Lower Rail	/	L N/A	Y				
A	Treads	/	F L N/A	Y				
	Risers	/	L N/A	Y				
	Tread edge	/	L N/A	Y				
	Landing floor	/	L N/A	Y				
	Stringer	/	L N/A	Y				
	Lattice	/	L N/A	Y				
A	Drain Pipes	/	L N/A	Y				
	Elec Conduit	/	L N/A	Y				
	Fill Pipe	04	L N/A	Y				
	Overhang Trm	/	L N/A	Y				
	Lamp Post	/	L N/A	Y				
	Storm Frames	18	F M/L A/M L N/A	Y				

Soil Test Results (Must be less than 400 ppm for play area / 1200 ppm for bare soil)

LOCATION	AREA MEASUREMENT (Square Feet)	RESULT (PPM)	REMED DATE	REMED METH
Play Area				
Bare Soil				
Comments				

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 25 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property

50 MAIN ST

Apt #

City

ACTON

EXTERIOR B Side

SIDE B	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
B	Siding	99	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trim	/	L N/A	Y				
	Upper Trim	NA	L N/A	Y				
	Win Above 5'	NA	L N/A	Y				
	Porch Above 5'	/	L N/A	Y				
B 1 2 3 4	Storm Door	.	L N/A	Y				
	Storm Door Edge	.	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
B 1 2 3 4	Storm Door	/	L N/A	Y				
	Storm Door Edge	/	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
B 1 2 3 4	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
B #	Window Sill	99	L N/A	Y				
	Win Casing	99	L N/A	Y				
	Window Sash	99	L N/A	Y				
B #	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
	Window Sash	/	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 2880 SQ IN)

SIDE	LOCATION	MEASURE LOOSE PAINT	IC DATE	IC METHOD
B				
B				
B				
B				

SIDE B	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
B #	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
	Window Sash	/	L N/A	Y				
B #	Cellar Win Sill	99	A/M L N/A	Y				
	Cel Win Frame	99	L N/A	Y				
	Cel Win Sash	10	L N/A	Y				
B #	Screen Frame	/	L N/A	Y				
	Cellar Win Sill	.	A/M L N/A	Y				
	Cel Win Frame	/	L N/A	Y				
B #	Cel Win Sash	/	L N/A	Y				
	Screen Frame	/	L N/A	Y				
B #	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Frame	/	L N/A	Y				
	Cel Win Sash	/	L N/A	Y				
B #	Screen Frame	/	L N/A	Y				
	Foundation	NA	L N/A	Y				
	Bulkhead	/	L N/A	Y				
B #	Fences	100	L N/A	Y				
	Shutters	/	L N/A	Y				
B #	Newel post	.	L N/A	Y				
	Railing Cap	/	A/M L N/A	Y				
	Handrail	.	A/M L N/A	Y				
	Balusters	/	L N/A	Y				
	Lower Rail	/	L N/A	Y				
	Treads	.	F L N/A	Y				
	Risers	/	L N/A	Y				
	Tread edge	.	L N/A	Y				
	Landing floor	/	L N/A	Y				
	Stringer	/	L N/A	Y				
B #	Lattice	.	L N/A	Y				
	Drain Pipes	.	L N/A	Y				
	Elec Conduit	.	L N/A	Y				
	Oil Fill Pipe	/	L N/A	Y				
B #	Overhang Trim	.	L N/A	Y				
	Support Clmns	/	L N/A	Y				
		.	F M/L A/M L N/A	Y				
B #		.	F M/L A/M L N/A	Y				
		.	F M/L A/M L N/A	Y				

Soil Test Results (Must be less than 400 ppm for play area / 1200 ppm for bare soil)

LOCATION	AREA MEASUREMENT (Square Feet)	RESULT (PPM)	REMED DATE	REMED METH
Play Area				
Bare Soil				
Comments				

M-3801

Inspector (print)

Lic #

Signature _____

Date _____

Page 26 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic #

Signature

Date _____

Address of Property

Apt #

City

PORCH BC (side) 1ST (floor)

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A B	Siding	99	L N/A	Y				
C D	Corner Boards	/	L N/A	Y				
	Upper Trim	/	L N/A	Y				
	Ceiling	/	L N/A	Y				
	Joists	/	L N/A	Y				
	Storm Door	00	L N/A	Y				
A B	Strm Door Edge	/	F L N/A	Y				
C D	Door	00	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	01	L N/A	Y				
3 4	Door Jamb	01	F L N/A	Y				
	Threshold	NC	L N/A	Y				
	Kickplate	01	L N/A	Y				
	Storm Door	NC	L N/A	Y				
A B	Strm Door Edge	/	F L N/A	Y				
C D	Door	01	L N/A	Y				
	Door Edge	/	F L N/A	Y				
1 2	Door Casing	99	L N/A	Y				
3 4	Door Jamb	99	F L N/A	Y				
	Threshold	01	L N/A	Y				
	Kickplate	/	L N/A	Y				
A B	Window Sill	VA	A/M L N/A	Y				
C D	Win Casing	VA	L N/A	Y				
1 2	Window Sash	VA	L N/A	Y				
3 4	Mullions	/	L N/A	Y				
A B	Window Sill	01	A/M L N/A	Y				
C D	Win Casing	01	L N/A	Y				
1 2	Window Sash	VA	L N/A	Y				
3 4	Mullions	/	L N/A	Y				
A B	Window Sill	/	A/M L N/A	Y				
C D	Win Casing	/	L N/A	Y				
1 2	Window Sash	/	L N/A	Y				
3 4	Mullions	/	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

[illegible]

(dust)* - Applies only to porches used as interior space
COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can be made intact only by a licensed deleader

SIDE	LOCATION	MEASURE LOOSE PAINT (MORE THAN 2880 SQ IN)	IC DATE	IC METHOD

1

Check the box if this ROOM is RULED OUT for encapsulation because there are 3 or more A/M surfaces with adhesion problems

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 27 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property 90 MAIN ST

Apt #

City ACTON

EXTERIOR C Side

SIDE C	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
C	Siding	99	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trim	/	L N/A	Y				
	Upper Trim	NA	L N/A	Y				
	Win Above 5'	NA	L N/A	Y				
	Porch Above 5'	/	L N/A	Y				
C	Storm Door	/	L N/A	Y				
	Strm Door Edge	/	F L N/A	Y				
	Door BSMR 01	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	99	L N/A	Y				
	Door Jamb	99	F L N/A	Y				
C	Threshold	01	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Storm Door	/	L N/A	Y				
	Strm Door Edge	/	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
C	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
C	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
C	Window Sash	/	L N/A	Y				
	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
	Window Sash	/	L N/A	Y				
	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 2880 SQ IN)

SIDE	LOCATION	MEASURE	LOOSE PAINT	IC DATE	IC METHOD
C					
C					
C					
C					

SIDE C	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
C	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
	Window Sash	/	L N/A	Y				
	Cellar Win Sill	99	A/M L N/A	Y				
	Cel Win Frame	99	L N/A	Y				
	Cel Win Sash	14	L N/A	Y				
C	Screen Frame	/	L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Frame	/	L N/A	Y				
	Cel Win Sash	/	L N/A	Y				
	Screen Frame	/	L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
C	Cel Win Frame	/	L N/A	Y				
	Cel Win Sash	/	L N/A	Y				
	Screen Frame	/	L N/A	Y				
	Foundation	NC	L N/A	Y				
	Bulkhead	/	L N/A	Y				
	Fences	/	L N/A	Y				
C	Shutters	/	L N/A	Y				
	Newel post	/	L N/A	Y				
	Railing Cap	/	A/M L N/A	Y				
	Handrail	/	A/M L N/A	Y				
	Balusters	/	L N/A	Y				
	Lower Rail	/	L N/A	Y				
C	Treads	/	F L N/A	Y				
	Risers	/	L N/A	Y				
	Tread edge	/	L N/A	Y				
	Landing floor	/	L N/A	Y				
	Stringer	/	L N/A	Y				
	Lattice	/	L N/A	Y				
C	Drain Pipes	NC	L N/A	Y				
	Elec Conduit	/	L N/A	Y				
	Oil Fill Pipe	/	L N/A	Y				
	Overhang Trim	00	L N/A	Y				
	Support Clmns	0.1	L N/A	Y				
		/	F M/I A/M L N/A	Y				
C		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				
		/	F M/I A/M L N/A	Y				

Soil Test Results (Must be less than 400 ppm for play area / 1200 ppm for bare soil)

LOCATION	AREA MEASUREMENT (Square Feet)	RESULT (PPM)	REMED DATE	REMED METH
Play Area				
Bare Soil				
Comments				

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 28 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property

90 MAIN ST

Apt #

City

ACTON

EXTERIOR D Side

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
D	Siding	99	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trm	/	L N/A	Y				
	Upper Trm	N/A	L N/A	Y				
	Win Above 5'	N/A	L N/A	Y				
	Porch Above 5'	/	L N/A	Y				
D	Storm Door	/	L N/A	Y				
	Strm Door Edge	/	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
D	Storm Door	/	L N/A	Y				
	Strm Door Edge	/	F L N/A	Y				
	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
	Kickplate	/	L N/A	Y				
	Window Sill	99	L N/A	Y				
	Win Casing	99	L N/A	Y				
#1	Window Sash	62	L N/A	Y				
	Window Sill	99	L N/A	Y				
#2	Win Casing	99	L N/A	Y				
	Window Sash	62	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can only be made intact by a Deleader (MORE THAN 2880 SQ IN)

SIDE	LOCATION	MEASURE	LOOSE PAINT	IC DATE	IC METHOD
D					
D					
D					
D					

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
D	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
	Window Sash	/	L N/A	Y				
#1	Cellar Win Sill	99	A/M L N/A	Y				
	Cel Win Frame	99	L N/A	Y				
	Cel Win Sash	13	L N/A	Y				
#1	Screen Frame	/	L N/A	Y				
	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Frame	/	L N/A	Y				
#1	Cel Win Sash	/	L N/A	Y				
	Screen Frame	/	L N/A	Y				
#1	Cellar Win Sill	/	A/M L N/A	Y				
	Cel Win Frame	/	L N/A	Y				
	Cel Win Sash	/	L N/A	Y				
#1	Screen Frame	/	L N/A	Y				
	Foundation	NE	L N/A	Y				
	Bulkhead	/	L N/A	Y				
#1	Fences	/	L N/A	Y				
	Shutters	/	L N/A	Y				
D	Newel post	/	L N/A	Y				
	Railing Cap	/	A/M L N/A	Y				
	Handrail	/	A/M L N/A	Y				
	Balusters	/	L N/A	Y				
	Lower Rail	/	L N/A	Y				
	Treads	/	F L N/A	Y				
	Risers	/	L N/A	Y				
	Tread edge	/	L N/A	Y				
	Landing floor	/	L N/A	Y				
	Stringer	/	L N/A	Y				
#1	Lattice	/	L N/A	Y				
	Drain Pipes	/	L N/A	Y				
	Elec Conduit	/	L N/A	Y				
#1	Oil Fill Pipe	/	L N/A	Y				
	Overhang Trm	00	L N/A	Y				
	Support Clmns	0.1	L N/A	Y				
#1			F MI A/M L N/A	Y				
			F MI A/M L N/A	Y				

Soil Test Results (Must be less than 400 ppm for play area / 1200 ppm for bare soil)

LOCATION	AREA MEASUREMENT (Square Feet)	RESULT (PPM)	REMED DATE	REMED METH
Play Area				
Bare Soil				
Comments				

Craig Anderson

M-3801

Inspector (print)

Lic #

Signature

Date

Page 29 Of 29

Craig Anderson

M/R-3801

Risk Assessor (print)

Lic#

Signature

Date

Address of Property

90 MAIN ST

Apt #

City

Acton

GARAGE

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
A	Siding	13	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trim	02	L N/A	Y				
	Upper Trim	NA	L N/A	Y				
A	Door	0.2	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	15	L N/A	Y				
	Door Jamb	12	F L N/A	Y				
	Threshold	/	L N/A	Y				
A	Window Sill	00	A/M L N/A	Y				
	Win Casing	0.1	L N/A	Y				
	Win Sash	NA	L N/A	Y				
A	Foundation	/	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

FENCE 0.1

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
C	Siding	1.2	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trim	/	L N/A	Y				
	Upper Trim	NA	L N/A	Y				
C	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
C	Window Sill	/	A/M L N/A	Y				
	Win Casing	/	L N/A	Y				
	Win Sash	/	L N/A	Y				
C	Foundation	NA	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can be made intact only by a licensed deleader

SIDE	LOCATION	ASURE	LOOSE PAINT	IC	IC
A	(MORE THAN 1440 SQ IN)			DATE	METHOD
A					
A					

SIDE	LOCATION	ASURE	LOOSE PAINT	IC	IC
C	(MORE THAN 1440 SQ IN)			DATE	METHOD
C					
C					

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
B	Siding	10	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trim	/	L N/A	Y				
	Upper Trim	NA	L N/A	Y				
B	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
B	Window Sill	NA	A/M L N/A	Y				
	Win Casing	NA	L N/A	Y				
	Win Sash	NA	L N/A	Y				
B	Foundation	NA	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

SIDE	LOCATION/ SURFACE	LEAD	TYPE OF HAZARD	URG HAZ?	IC DATE	IC METH	DELEAD DATE	DELEAD METH
D	Siding	12	L N/A	Y				
	Corner Boards	/	L N/A	Y				
	Lower Trim	/	L N/A	Y				
	Upper Trim	NA	L N/A	Y				
D	Door	/	L N/A	Y				
	Door Edge	/	F L N/A	Y				
	Door Casing	/	L N/A	Y				
	Door Jamb	/	F L N/A	Y				
	Threshold	/	L N/A	Y				
D	Window Sill	NA	A/M L N/A	Y				
	Win Casing	NA	L N/A	Y				
	Win Sash	NA	L N/A	Y				
D	Foundation	NA	L N/A	Y				

COMMENTS / STRUCTURAL DEFECTS

EXCLUDED SURFACES Surfaces listed in these boxes can be made intact only by a licensed deleader

SIDE	LOCATION	ASURE	LOOSE PAINT	IC	IC
B	(MORE THAN 1440 SQ IN)			DATE	METHOD
B					
B					
B					

SIDE	LOCATION	ASURE	LOOSE PAINT	IC	IC
D	(MORE THAN 1440 SQ IN)			DATE	METHOD
D					
D					
D					